

Interference noises from bass box (rattling) at left rear

Topic number	LI82.62-P-056934
Version	1
Design group	82.62 Loudspeakers, amplifiers, antennas
Date	09-05-2013
Validity	Model W166 with sound system (code 810 or 811)
Reason for change	
Reason for block	

Complaint:

Interference noises from bass box (H4/38) at left of luggage compartment

Cause:

Loose attachment of bass box due to incorrect / overtightened speed nuts (threaded clips)

Remedy:

Replace both speed nuts (threaded clips) and bolts at top of bass box (H4/38)

Symptoms
Communication/information / Entertainment / Audio / Speakers emit interference noise
Communication/information / Entertainment / Audio / Poor audio quality

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 004 994 12 45			Speed nut M5	2	Bass box speaker M5	X	
A 140 990 06 36			Bolt	2	Bass box speaker M5x14	X	

Validity		
Vehicle	Engine	Transmission
M (166)	*	*