

Reference	SSM66437
Models	Range Rover (All New) / L405
Title	13MY Touch Screen Display blank during ignition cycle.
Category	Electrical
Last modified	20-Jun-2013 00:00:00
Symptom	207000 Entertainment Systems
Content	<p>Issue: A customer may report that the Touch Screen Display remains black on vehicle entry, however all button requests do respond when selected (an audible sound from the soft keys can be heard) but without the backlight. The audio system will remain functional.</p> <p>Cause: Compatibility of software timing issues in previous software levels.</p> <p>Action: Should a customer report the concern, download the latest Touch Screen Display (Front Control Display Interface Module) software using Symptom Driven Diagnostics with DVD134, patch file 2 or later installed.</p>