# Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2013 Mazda Motor of America, Inc.

Subject:	RATTLE NOISE FROM STEERING SYSTEM	Bulletin No:	06-001/13
.s ==s.s= FROM GTEENNO GTGTEM	NATILE NOISE I NOM STEENING STOTEM	Last Issued:	08/22/2013

## **BULLETIN NOTE**

- This bulletin supersedes the previous bulletin 06-002/12, issued on 05/11/12. The PART(S) and WARRANTY INFORMATION have been revised.
- Changes are noted below in Red beside the change bar.

# APPLICABLE MODEL(S)/VINS

2011-2012 Mazda2 vehicles with VINs lower than JM1 DE 1\*\*\*\*\* 140732 (produced before December 10, 2011)

# **DESCRIPTION**

When driving straight on a rough road at approximately 6-19 mph (10-30 km/h), some vehicles may exhibit a rattle noise from the front passenger side floor.

Customers having this concern should have their vehicle repaired using the following repair procedure.

#### REPAIR PROCEDURE


- 1. Verify customer concern matches all of the following conditions:
  - The noise occurs when driving on rough road at approximately 6-19 mph (10-30 km/h).
  - The noise is more pronounced in the front passenger side floor rather than the driver side floor.
  - · The noise does not occur on flat and smooth road.
  - The noise continues even after rotating the steering wheel in any direction.

 Bulletin No: 06-001/13
 Last Issued: 08/22/2013

 © 2013 Mazda Motor of America, Inc.

2. Use Special Service Tool (SST) ChassisEAR / EngineEAR II Combo JSP06608 or Wireless ChassisEAR JSP97202 to confirm rattle noise is coming from the rack end bushing (A) (shown below):

NOTE: SST JSP06608 and JSP97202 are available for purchase on M-Store.

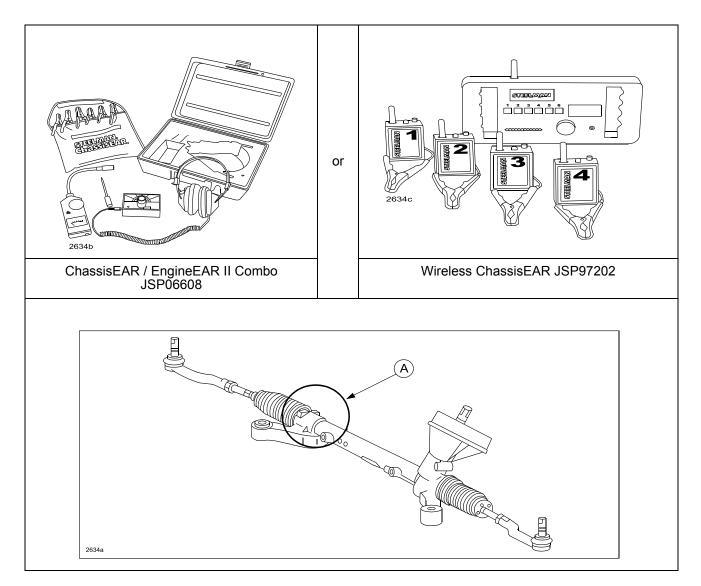

- 3. If step 1-2 apply, replace the steering gear assembly according to MS3 online or Workshop Manual (section 06-13 STEERING GEAR AND LINKAGE REMOVAL/INSTALLATION).
- 4. Verify repair.

<b>Bulletin No:</b> 06-001/13	Last Issued: 08/22/2013
© 2013 Mazda Motor of America, Inc.	

# PART(S) INFORMATION

Part Number	Description	Qty.
DF95-32-110A	Steering Gear	1

# WARRANTY INFORMATION

## NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	82
Damage Code	97
Part Number Main Cause	DF95-32-110A
Quantity	1
Operation Number / Labor Hours:	XXJ9KXRX / 1.9 Hrs.

**NOTE:** Front wheel alignment time is included in the labor hour shown above.