

© 2013 Mazda Motor of America, Inc.

Subject: DRIVERS SIDE SEATBACK RECLINING POSITION CHANGES BY ITSELF WHEN CUSTOMER EXITS THE VEHICLE	Bulletin No: 09-020/13
	Last Issued: 09/05/2013

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-020/13, issued on 07/11/13. The APPLICABLE MODEL(S)/VINS, DESCRIPTION, REPAIR PROCEDURE and PART(S) INFORMATION have been revised.
- Changes are noted below in Red beside the change bar.


APPLICABLE MODEL(S)/VINS

2013-2014 CX-5 vehicles equipped with power seats, with VINs lower than JM3 KE***** 338025 (produced April 1, 2013)

DESCRIPTION

Some customers may complain that the driver side seatback reclining position seems to change by itself. This may be caused unknowingly by the customer when they exit the vehicle. The customer's leg may be contacting the recliner switch knob and changing the seatback reclining position.

NOTE: This issue does not involve any movement of the seatback while the vehicle is being driven.

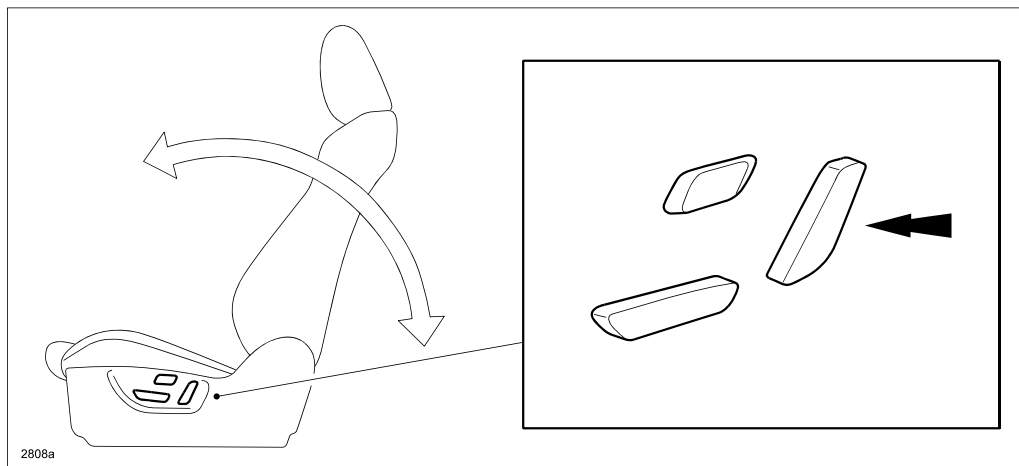

- The configuration of the recliner switch knob has been changed to eliminate this concern. Customers having this concern should have their vehicle repaired using the following repair procedure.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Bulletin No: 09-020/13 © 2013 Mazda Motor of America, Inc.	Last Issued: 09/05/2013
--	--------------------------------

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the recliner switch **knob** with a modified new part according to the instructions on MS3 online or the Workshop Manual (section 09-13 FRONT SEAT SIDE COVER REMOVAL/INSTALLATION).
3. Verify the repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
KD35-88-1H5 -02	Recliner Switch Knob (LH)	1	Replace recliner switch knob only. Do not replace recliner switch.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	89
Damage Code	9H
Part Number Main Cause	KD35-88-1H5 -02
Quantity	1
Operation Number / Labor Hours:	XXJ8FXRX / 0.2 Hrs.