

Subject: REAR DIFFERENTIAL VENT CAP FLUID LEAK IN COLD AMBIENT TEMPERATURES	Bulletin No: 03-003/13
	Last Issued: 10/31/2013

APPLICABLE MODEL(S)/VINS

2011 Tribute equipped with AWD


DESCRIPTION

Some vehicles may exhibit an occasional fluid leak coming from the rear differential vent cap in temperatures below 32 degrees Fahrenheit (0 degrees Celsius) under certain conditions.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Inspect the rear drive unit (A) for oil leaking from the vent cap (B) located on the rear cover.

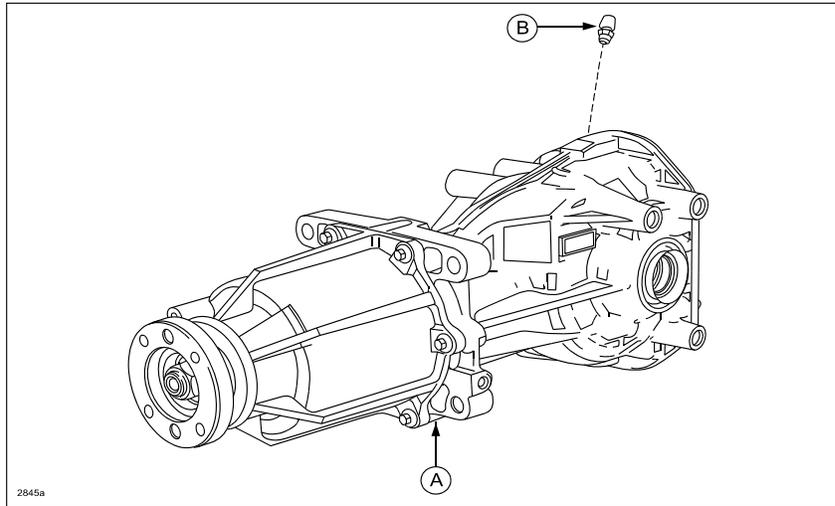

2. Is the rear differential vent cap leaking fluid?
 - a. No - This bulletin does not apply.
 - b. Yes - Proceed to step 3.

NOTE: A light residue found around the cap is normal.

3. Remove and discard the vent from the rear drive unit cover.
4. Install new vent.
5. Clean off any remaining residue.
6. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
ZZC1-17-530	Vent Valve Assembly	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Powertrain Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	76
Damage Code	91
Part Number Main Cause	ZZC1-17-530
Quantity	1
Operation Number / Labor Hours:	YY755XRX / 0.3 Hrs.