

Subject: DRIVER SEAT GRADUALLY MOVES DOWN BY ITSELF	Bulletin No: 09-010/13
	Last Issued: 10/31/2013

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-010/13 issued 04/10/13. The PART(S) INFORMATION has been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2013-2014 CX-5 vehicles without power seats

DESCRIPTION

Some vehicles (without power seats) may exhibit a driver seat that gradually moves down by itself. This concern may be caused when a load, which is applied to the seat during braking, exceeds a certain level that could impact the retaining mechanism of the seat lifter causing the seat to gradually move downward.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.

NOTE: Ensure the customer is not bumping or touching the adjuster by mistake when entering or exiting the vehicle.

2. Replace the driver seat adjuster unit with a modified part according to the instructions on MS3 online or the Workshop Manual (section 09-13 FRONT SEAT ADJUSTER UNIT REMOVAL/INSTALLATION - DRIVER-SIDE (WITHOUT POWER SEAT SYSTEM)).
3. Verify repair.

Bulletin No: 09-010/13 © 2013 Mazda Motor of America, Inc.	Last Issued: 10/31/2013
--	--------------------------------

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
KDY3-88-H50	Driver Seat Adjuster Unit (LH)*	1	Confirm the part number in the EPC for the subject VIN and place an order for the corresponding (modified) service part.
KDY5-88-H50	Driver Seat Adjuster Unit (LH)*	1	
KF61-88-1H5 -02	Recliner knob (with lever type recliner knob) (LH)	1	Replacement Parts
KD45-88-857 -02	Lifter knob (LH)	1	
KD45-88-585	Front seat side cover clip	4	

* The driver seat adjuster unit parts listed in the table above are specific to the customer complaint (Driver Seat Gradually Moves Down By Itself) outlined in this service bulletin. When replacing the seat for any other reason, use the EPC to determine the correct seat part number(s).

WARRANTY INFORMATION

NOTE:

- This repair only applies to non-power seat system vehicles.
- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	67
Damage Code	97
Part Number Main Cause	(SEE PART(S) INFORMATION)
Quantity	1
Operation Number / Labor Hours	XXJ1PXRX / 0.7 Hrs.

NOTE:

- This service bulletin does not apply to vehicles equipped with power seats.
- Enter "Replacement Part" numbers in Related Part Number column.