# Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2013 Mazda Motor of America, Inc.

Subject: Bulletin No: 09-038/13

VARIOUS AUDIO SYSTEM CONCERNS WITH TUNER AND AMP UNIT (TAU)

Last Issued: 12/19/2013

## APPLICABLE MODEL(S)/VINS

2014 Mazda3 vehicles (with MAZDA CONNECT) with VINs lower than JM1BM\*\*\*\*\*\*109600 (produced before September 1, 2013)

#### DESCRIPTION


Some vehicle may experience any one of the symptoms below that can be resolved with a modified TAU.

- AM/FM/XM cannot be selected as they are grayed out
- · Radio station returns to 87.9MHz on its own
- · Audio sound setting resets on its own
- TAU version is displayed as "not available"

Customers having any of these concerns should have their vehicle repaired using the following repair procedure.

#### REPAIR PROCEDURE

- 1. Verify customer concern.
- On vehicle with a touchscreen (A), remove the TAU (B) and replace with a modified one. Refer to MS3
  online instructions or Workshop manual (section 09-20 TUNER AND AMP UNIT (TAU) REMOVAL/INSTALLATION).

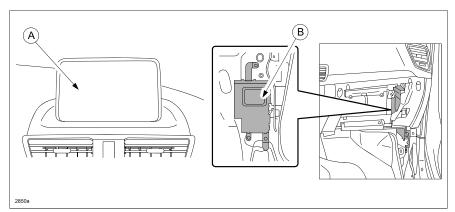

**NOTE:** When replacing the tuner and amp unit (TAU) with a new one for any reason, refer to TSB 09-030/ 13 SIRIUSXM REGISTRATION AFTER TUNER AND AMP UNIT (TAU) REPLACEMENT.

3. Verify repair.

Page 1 of 2

Bulletin No: 09-038/13	Last Issued: 12/19/2013
© 2013 Mazda Motor of America, Inc.	

# PART(S) INFORMATION

Use exchange unit only. DO NOT automatically order a new part for warranty replacement.

Part Number	Description	Qty.	Notes
BHP1-66-DRX*	TAU	1	Confirm the part number in the EPC for the subject VIN.
BHP5-66-DRX*	TAU	1	LFC for the subject viiv.
BJD5-66-DRX*	TAU (w/ XM Radio)	1	
BJD6-66-DRX*	TAU (w/ XM Radio)	1	

<sup>\*</sup> Any suffix

### **WARRANTY INFORMATION**

#### NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	61
Damage Code	9H
Part Number Main Cause	****-66-DRX
Quantity	0
Operation Number / Labor Hours:	XXK2C2XRX / 0.3 Hrs.