

Reference	SSM67897
Models	Range Rover Sport / L320 LR2 / L359 Range Rover Evoque / L538 Range Rover (All New) / L405 LR4 / L319 Range Rover / L322 Range Rover Sport / L494
Title	Vehicle seat memory module logs U1A4C 00, 2010 my onwards
Category	Body
Last modified	06-Sep-2013 00:00:00
Symptom	101000 Seating
Content	<p><u>Issue</u> Incorrectly configured Seat Modules can cause incorrect functioning of the seat, or battery drain issues. The vehicle seat memory module logs U1A4C 00, "build end of line mode active"</p> <p><u>Cause</u> The seat module has been incorrectly configured to the vehicle.</p> <p><u>Action</u> Using SDD, reconfigure the Seat Memory Module as a NEW module. Reconfigure as existing module will not solve this issue. After completing the process, check for correct function of the windows and time settings on the vehicle before handing back to the customer</p>