

Reference	SSM68077
Models	Range Rover Sport / L494
Title	ABS Software Will Not Update UPS Q323
Category	Diagnostic Software Hardware
Last modified	05-Sep-2013 00:00:00
Symptom	000101 Diagnostic Concerns
Content	<p><b>Issue:</b> Land Rover have received a small amount of reports that the ABS software will not update at first attempt when carrying out Update Prior to Sale Notice (UPS Q323)</p> <p><b>Cause:</b> Secondary boot loader strategy.</p> <p><b>Action:</b> When carrying out UPS Q323, if when attempting configuration of the existing ABS module an error occurs during the download, carry out the following steps:</p> <ol style="list-style-type: none"><li>1. Exit the current Symptom Driven Diagnostic (SDD) session and disconnect from diagnostic socket.</li><li>2. Disconnect the battery negative lead for a period of 5 minutes.</li><li>3. Re-connect the battery negative lead.</li><li>4. Connect SDD to the vehicle start a new session and select configure existing ABS module.</li></ol> <p>Note: An updated secondary boot loader strategy will be incorporated into a future patch file release to negate the need for a second attempt at ABS download.</p>