

Initialization of Power Window During PDS

Service Category General

Section Pre-Delivery Service

Market USA

Lexus Supports ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2015	IS250C, IS350C	

Introduction

As a result of the removal of the DCC fuse, the “one-touch open and close” and “jam protection” functions of each door’s power window will be inoperative due to loss of the power window position memory stored in the microcomputer.

Initialize each door’s power window after installing the DCC fuse into its original location.

NOTE

Anytime the battery terminal has been disconnected, each door’s power window **MUST** be initialized.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
N/A	Not Applicable to Warranty	–	–	–	–


Initialization Procedure

1. Cycle the ignition switch to the “IG-ON” position.

NOTE

When not initialized, the power window switch for the driver’s door window will blink.

Figure 1.

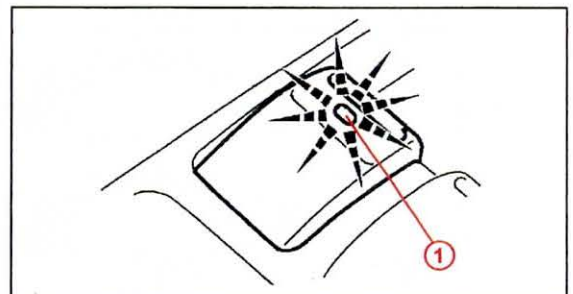


1 Switch Illumination

Initialization of Power Window During PDS

Initialization Procedure (Continued)

2. Close the driver and passenger doors and verify the quarter windows and retractable hardtop are fully closed.
3. Push "DOWN" the driver's door power window switch and lower the window halfway.
4. Pull "UP" the driver's door power window switch until the window closes, and hold it until the switch stops blinking and remains illuminated.

Figure 2.

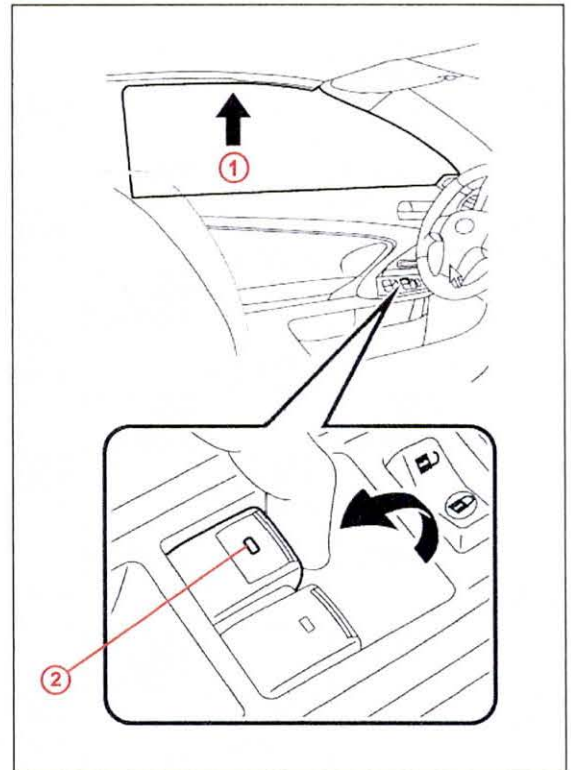

NOTE

- It may be necessary to hold the power window switch for over 10 seconds for the initialization to complete.
- Jam protection function is enabled through the above initialization procedure.

1	Completely Closed
2	Switch Illumination

5. Check for proper operation of the "one-touch open and close" function by fully pushing the switch "DOWN" once and fully pulling the switch "UP" once.

NOTE

Open the door and confirm that the window automatically retracts (lowers) slightly. Confirm that the window automatically returns to the fully closed position when the door is closed. If not, initialization is not complete. Please repeat steps 1 – 5.

6. Repeat steps 1 – 5 for passenger door power window.