A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the Elsa Newsletter section in the Technician References menu.

VW Elsa Newsletter



Edition 104: September 22, 2014

Content

- Mandatory wiTECH Software
 Update: MY2009 Routan
- Reminder: VW Google is Now Available through vwhub.com
- Technical Bulletins
- Pending Service Solutions
- Tech Tips
- Campaigns
- Updates
- Suggestions



Mandatory wiTECH Software Update: MY2009 Routan

MY2009 Routan / WIN Control Module (WCM) programing.

To all VW dealer technicians: The WCM replacement parts was recently superseded to the new supplier Marquardt.

In order to program the new Marquardt WCM, the wiTECH application software **must** be updated to V13.04.15. Please review VSE -14-18 on ServiceNet under Workshop-Equipment>

wiTECH/ StarMobile-Diagnostic-Tool> Service-Information > <u>VSE 14-18 wiTECH Software</u> Installation Instructions and follow procedure.

Reminder: VW Google is Now Available through vwhub.com

VW Google, a Google-powered portal for searching selected repair information is now available as a direct link on www.com. Elsa users can now access **VW Google** by logging into wwhub.com and clicking the "VW Google" link just under the ElsaPro link.

The new link will be in addition to the button available in the Technical Assistance section of Elsa. This link will only work for users with access to ElsaPro. **Tips: Searching for TB's in VW Google**


Users can find all Technical Bulletins (TB) on VW Google using the following search methods (The example TB used is **"26-12-07 - Ad Blue Filling at Delivery (2031040/1)**"):

- Using the TB group number (26-12-07):

Searching by group number allows the user to browse all the TB's available for that specific group, like on ServiceNet. There are three ways to use the group search:

- A. By repair group # (26)
- B. By Repair Group # + Publishing Year (26-12)
- C. By Repair Group # + Year + Publishing # (26-12-07)


Example (Repair Group # + Publishing Year):

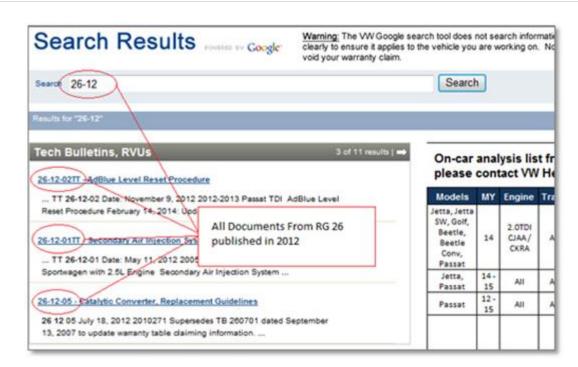


- Or the TB title:



- Or the TB instance:

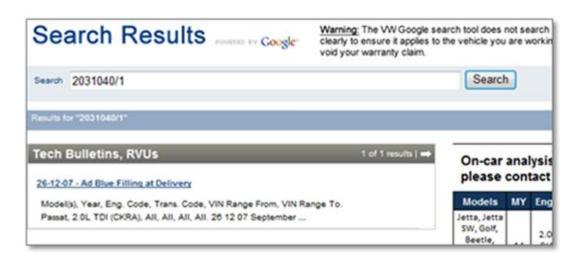

- Or by Key word search:

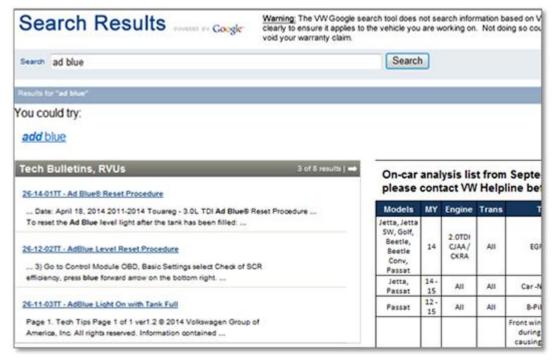

Back to top

Technical Bulletins

01 14 21 - 2034898 Supersedes T.B. V011411 dated April 21, 2014 to update 2009 Jetta Wagon (1K5) with (CBEA) labor operation in warranty table.

MIL ON, DTC P0401 Exhaust Gas Recirculation Flow Insufficient Stored in ECM Fault Memory, Could be accompanied with Fault P2463 DPF Soot Accumulation

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta, Jetta Wagon	2009	2.0L TDI (CBEA)	All	All	All
Golf, Jetta Sedan, Jetta SportWagen, Golf Wagon	2010– 2014	2.0L TDI (CJAA)	All	All	All
Beetle, Beetle Convertible	2013– 2014	2.0L TDI (CJAA)	All	All	All


High soot loads prior to regeneration can cause possible restrictions in the EGR filter.

Production Solution: New software implemented in current production.

91 14 08 - 2038293 Stationary Vehicle Displayed While in Motion (Premium 8 Radio)

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta Hybrid	2013–2014	1.4L (CNLA)	All	All	All

The customer may report that while the vehicle is in motion, the display on the Premium 8 radio displays the "Stationary Vehicle" driving mode. This symptom is often intermittent and can be temporarily resolved by performing a key cycle. This condition only affects vehicles equipped with Premium 8 radio.

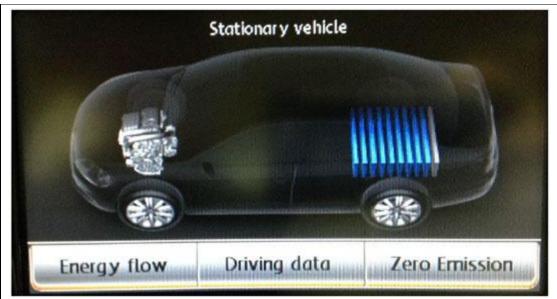

Production Solution: SW 0011 implemented into production in CW 37/14.

Pending Service Solutions

No new Pending Service Solutions this week.

Back to top

Tech Tips

23-06-28 TDI Pumpe Duse Engine, with Hard Starting Update to information: September 12, 2014					
Model(s)	Year	Eng.Code	Trans.Code		
B5/B6 Passat	2004>	2.0 L TDI	All		

For long crank/ difficulty starting with the engine hot: Before replacing any components for this complaint, drain the fuel from the vehicle and replace with known good diesel fuel from a reputable source. If the complaint still exists, check fuel pressure and injector timing.

92-14-04 Rear Washer Jet Leaks / Drips After Use				
Model(s)	Year	Eng.Code	Trans.Code	
A7 Golf/GTI	2015	All	All	

For the A7 Golf/GTI with a rear washer nozzle leaking after use (Installed in the high mount brake lamp housing). An updated washer nozzle is now available.

Replace with the latest part number available in ETKA.

Back to top

Campaigns

No new campaigns this week.

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: www.workshopinformation@vw.com

Back to top

© 2014 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.