

DanyD

BRP Service Dept - N/A



Posts: 672

Registered: 10-19-2011

Location: NA

Warranty Bulletin 2014-2 OBSOLETE to 2014-8

2 weeks ago

Please take note of the following warranty bulletin changes.

2014-2

Subject:

1. Fast Flasher Blink Rate
2. Possible Defective Ignition Key
3. Front Storage Compartment Cover and/or Seat Will Not Open - Defective Ignition Switch

Is now OBSOLETE, campaign numbers on this bulletin are no longer active.

This bulletin has been superseded by:

Warranty Campaign Bulletin 2014-8

Subject:

1. Fast Flasher Blink Rate
2. Possible Defective Ignition Key

What this means is that you have to refer to warranty bulletin 2014-8 for the eligible units of this bulletin.

In this bulletin you have to do the **flasher rate calibration of the Cluster on all units eligible for the bulletin** and **grind the tip of the key for the units with a key code in the attached list**.

It is no longer necessary to do the seat and front hood cable test.

If a seat or front hood doesn't open because the mechanism in the ignition switch is defective - replace the ignition switch under regular warranty.

If a key is stuck in the ignition switch - replace the ignition switch under regular warranty.

If a key does not turn but can be removed from the ignition switch - grind the tip as per instructions in the bulletin.

If the key turns and the key code is in the list - grind the key tip as per instructions in the bulletin.

DO NOT replace any ignition switches unless they are truly defective.

Dany D

Roadster Product Specialist