

TECHNICAL BULLETIN
LTB00586NAS1
06 JAN 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 303-03C

Radiator Leak

AFFECTED VEHICLE RANGE:

Range Rover (LG)

Model Year: 2013

VIN: DA001204-DA115165

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A low level coolant warning message may be displayed.

Cause: This may be caused by a moulding defect in the radiator, causing a leak from the top left end of the radiator.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

LR034553	Radiator	Quantity: 1
LR044466	O-ring	Quantity: 2
LR054871	O-ring	Quantity: 2

TOOLS:

No Tools Required

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Radiator - Renew - 5.0L NA	26.40.01	3.0	D1	LR034553
Radiator - Renew - 5.0L SC	26.40.01	3.6	D1	LR034553

 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1. Replace the radiator (see TOPIx Workshop Manual, Section 303-03C).