TECHNICAL BULLETIN LTB00626NAS1 06 JAN 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

<u>SECTION: 419-01A</u>

Alarm False Activation / 'Hood Open' Message Displayed on Instrument Cluster

AFFECTED VEHICLE RANGE:

LR2 (LF)

 Model Year:
 2008-2013

 VIN:
 8H001002-DH380669

LR4 (LA)

 Model Year:
 2010-2013

 VIN:
 AA510742-DA697644

 Model Year:
 2012-2013

 VIN:
 CH000447-DH852434

 Model Year:
 2014

 VIN:
 EA000002-EA323440

 Model Year:
 2013-2014

 VIN:
 DA001204-EA143002

 Model Year:
 2010-2013

 VIN:
 AA212147-DA814822

MARKETS:

NAS

CONDITION SUMMARY:

Situation: One or more of the following issues may be evident:

- The alarm is triggered for no apparent reason;
- The 'Hood Open' message is displayed on the Instrument Cluster; and/or
- A mislock sound is emitted when locking the vehicle.

Cause: These issues may be caused by a faulty hood open switch.

Action: Should the customer experience this concern, follow the appropriate Service Instruction (1 or 2) outlined below.

PARTS:

LR054331

Hood latch with integrated switch

Quantity: 1

TOOLS:

No Tools Required

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

ONOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

	(HOURS)	CODE	PART
86.77.20	0.9	42	LR041431
86.77.20	0.3	42	LR041431
86.77.20	0.4	42	LR041431
86.77.20	0.2	42	LR041431
86.77.20	0.2	42	LR041431
86.77.20	0.3	42	LR041431
	86.77.20 86.77.20 86.77.20 86.77.20	86.77.20 0.3 86.77.20 0.4 86.77.20 0.2 86.77.20 0.2	86.77.20 0.3 42 86.77.20 0.4 42 86.77.20 0.2 42 86.77.20 0.2 42


NOTE: Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION 1

SERVICE INSTRUCTION '1' FOR ALL VEHICLES EXCEPT LR2 (L359)

NOTE: Some components shown removed for clarity.

- 1. Refer to hood switch removal procedure (see TOPIx Workshop Manual, section 419-01A).
- **2.** When switch is removed, disconnect the release cable and remove the hood latch.

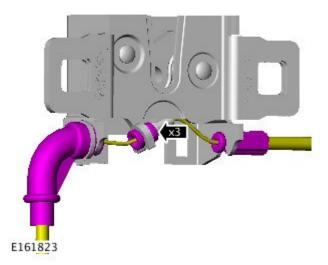

3. To install, reverse the removal procedure aligning the latch as follows.


- Loosen the two (2) hood latch bolts.
- Lower the hood and check for alignment.
- Open the hood and tighten the bolts to 10 Nm (7lb ft).
- Check the operation of the hood safety latch.
- If necessary, repeat the above adjustment procedure.

SERVICE INSTRUCTION 2

SERVICE INSTRUCTION '2' FOR LR2 (L359) VEHICLES ONLY


NOTE: Some components shown removed for clarity.

- 1. Remove the front bumper cover (see TOPIx Workshop Manual, section 501-19).
- **2.** Remove the two (2) fixing bolts and move the latch aside.

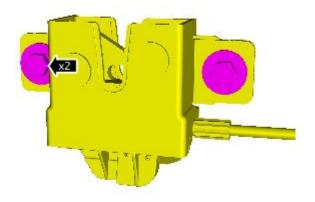


E161816

3. Disconnect the electrical connector on the hood switch.

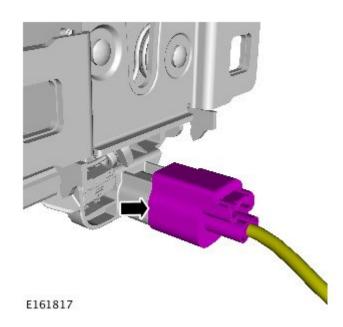

4. Disconnect the cable and remove the hood latch.

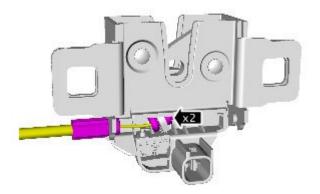

E161818

- 5. To install, reverse the removal procedure aligning the latch as follows.

 - Loosen the two (2) hood latch bolts.
 Lower the hood and check for alignment.
 Open the hood and tighten the bolts to 10 Nm (7lbF ft).

 - Check the operation of the hood safety latch.If necessary, repeat the above adjustment procedure.