

TECHNICAL BULLETIN
LTB00628NAS1
10 JAN 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-28A / -28B

Roof Panel Damaged By A-Pillar Trim

AFFECTED VEHICLE RANGE:

Range Rover Evoque (LV)

Model Year: 2012 Onwards

VIN: CH000447 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: Paint damage to the roof panel at the A-pillar area may be evident.

Cause: This may be caused by a clash between the A-pillar trim and roof panel.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

LR059875	A-Pillar Trim - Right	Quantity: 1
LR059868	A-Pillar Trim - Left	Quantity: 1
LR033144	Clip	Quantity: 10
LR002229	Cup	Quantity: 10

TOOLS:

No Tools Required

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Replace A-pillar trim; touch up roof paint - One side	76.43.89/42	0.20	07	LR046652
Replace A-pillar trim; touch up roof paint - Both sides	76.43.89/43	0.40	07	LR046652

 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1.  **NOTE: Left-side shown; right-side similar.**

Inspect both sides of the vehicle roof panel for damage in the area shown.

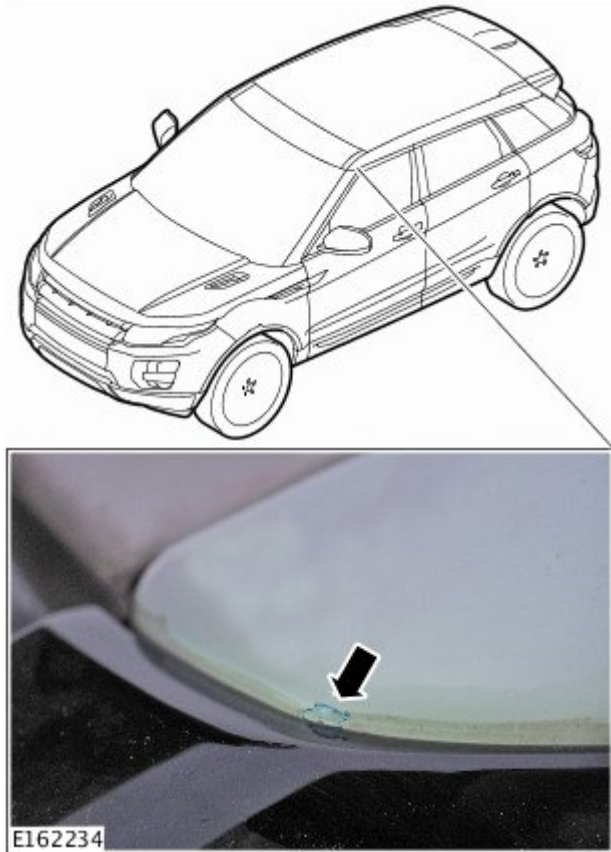


2.  **NOTE: Left-side shown; right-side similar.**


Remove the left-side A-pillar trim screw.



3. Remove the four (4) clips.
- Remove the left-side A-pillar trim.

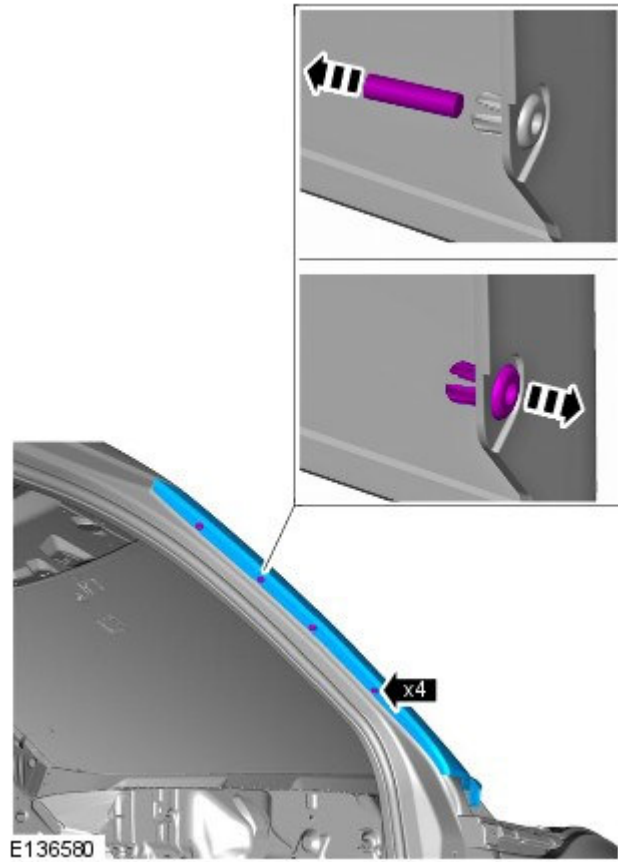

4. Repair and touch up the affected area.

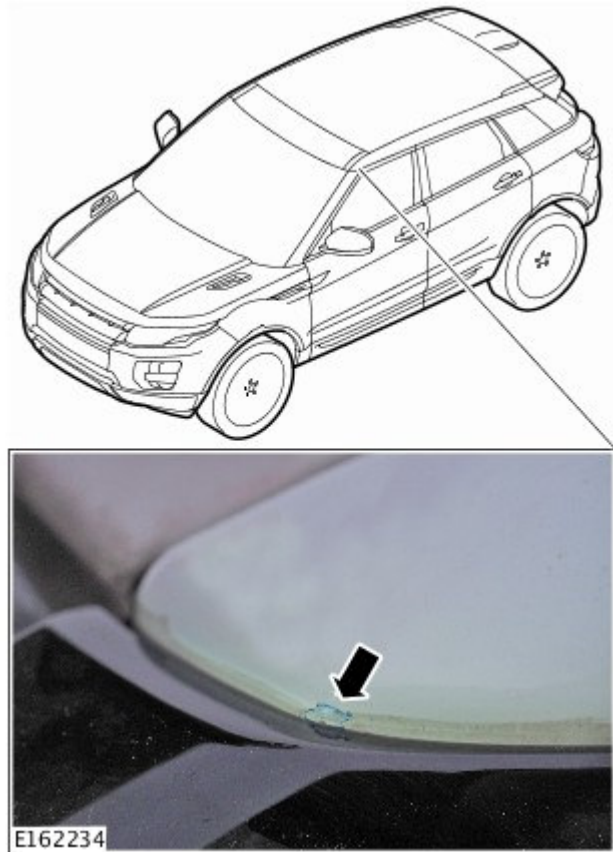

5. Install the new left-side A-pillar trim:

- Install four (4) new clips.
- Install the A-pillar trim screw.

6. If necessary, repeat steps 2-5 to the right-side A-pillar / roof panel.