

Reference	SSM71038
Models	Range Rover Sport / L320
Title	Minor Air Suspension Leak From The Air Spring Top Mount.
Category	Chassis
Last modified	15-Jan-2014 00:00:00
Symptom	304000 Suspension System
Content	<p><u>Issue:</u> Customers may report that after parking their vehicle, the front suspension is leaning or that a minor air leak can be heard from the front air spring assembly. 5.0L S/C Vehicles Only. Affected VIN range AA215623 - DA814822.</p> <p><u>Cause:</u> Air leak from the top mount.</p> <p><u>Action:</u> Should a customer express concern and the air spring assembly requires replacing, follow the Service Instruction outlined in TOPIx, Section 204-05, Vehicle Dynamic Suspension, using part number LR052866.</p> <p>SRO code 60.21.01 - 1.20 hours.</p> <p>NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.</p> <p>NOTE: Normal Warranty policies and procedures apply.</p>