

<b>Reference</b>	SSM71900
<b>Models</b>	Range Rover / L405 Range Rover Sport / L494
<b>Title</b>	Steering Shaft/Column Squeak
<b>Category</b>	Chassis
<b>Last modified</b>	04-Jul-2014 00:00:00
<b>Symptom</b>	303000 Steering/Handling
<b>Attachments</b>	Lubrication area.pdf
<b>Content</b>	<p>Issue:</p> <p>Customer reports a squeak noise when turning the steering wheel.</p> <p>Cause:</p> <p>Misaligned bearing leading to contact between the steering shaft and rubber bulkhead seal.</p> <p>Action:</p> <p>If a customer reports this concern then please start diagnosis by applying a lubricant spray into the bearing from the engine bay (as per photos in attachment). If this eliminates the noise then proceed with disassembling and re-aligning the bearing as per TOPIx workshop manual 211-04.</p> <p>Note: Please raise an ePQR if you do find this issue.</p>

