

Reference	SSM71890
Models	LR4 / L319 Range Rover / L405
Title	Transmission Selector Switch Fails to Rise
Category	Electrical
Last modified	18-Aug-2014 00:00:00
Symptom	203000 Basic Electrical
Content	<p>Issue: A customer may report that the Transmission Control Switch (Rotary selector) intermittently fails to rise when the Start/ stop ignition button is pressed or may rise and fall immediately, particularly where ambient temperatures are less than 4 degrees C.</p> <p>Cause: The motor within the Transmission Selector assembly may be at the lower end of the specification preventing it from rising within the required time span.</p> <p>Action: Where Service Action Q355 'Rotary Gear Shift Selector Fails to Rise' has previously been completed and the customer has reported the issue above, replace the Transmission Control Switch.</p>