

Reference	SSM72132
Models	LR2 / L359 Range Rover Evoque / L538
Title	M66 manual transmission turret housing incorrect part - LR022071 LR072971
Category	Driveline
Last modified	23-Dec-2014 00:00:00
Symptom	503000 Automatic Transmission Engagement Concerns
Attachments	A1.pdf

Content **Issue:** A technician may find when replacing the M66 gearbox Turret Housing for a gear change selection or stop/start fault that an incorrect turret may be supplied.

This affects:


- Vehicles fitted with M66 6 speed manual Transmissions
- Freelander 2/LR2 (LF) Model Year: 2013-2014 (VIN: DH321215-EH439912)
- Range Rover Evoque (LV) Model Year: 2013 Onwards (VIN: DH85818 Onwards)

Cause: In March 2013 a hall effect sensor turret was introduced, but was not given a service part number. Dealers ordering part No.LR022071 may have either the an inductive or hall effect Turret supplied. This may be incorrect for the vehicle being repaired.


Action: The following part Numbers are now available for the M66 6 speed manual Transmission:

- LR022071-Inductive sensor Turret
- LR072971-Hall effect sensor Turret.

Please refer to the attachment 'A' to help identify which part is fitted to the vehicle.

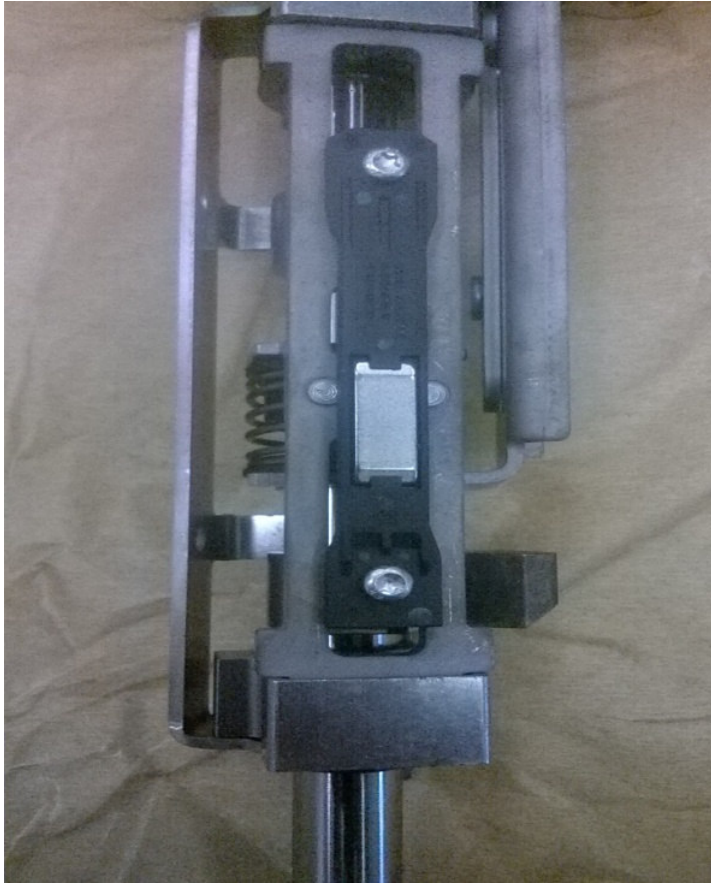

LR022071

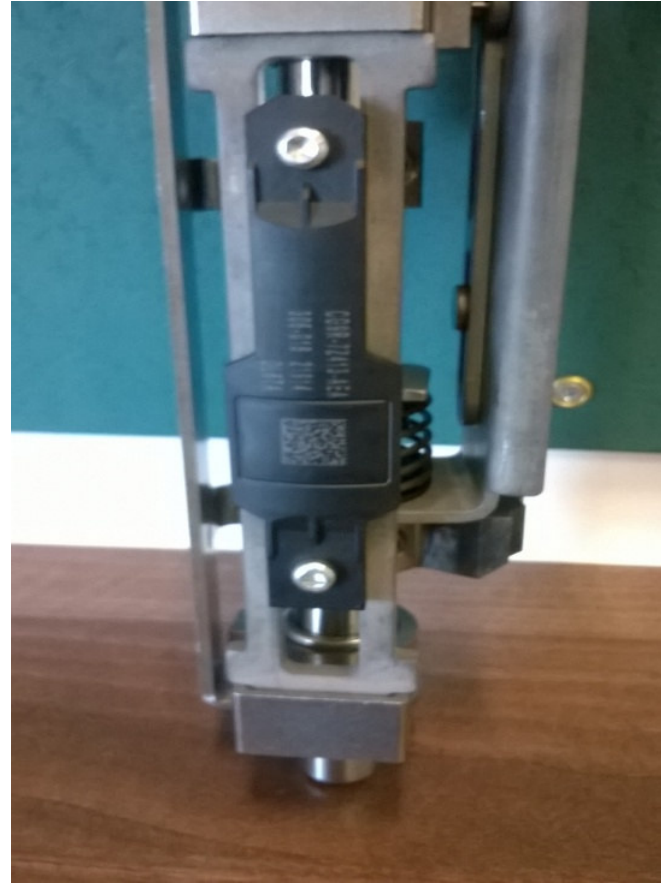

LR072971