

<b>Reference</b>	SSM72133
<b>Models</b>	Range Rover / L405 Range Rover Sport / L494
<b>Title</b>	Model: 15MY 3.0L and 5.0L Petrol Supercharger Derivatives Only
<b>Category</b>	Chassis
<b>Last modified</b>	24-Dec-2014 00:00:00
<b>Symptom</b>	301000 Service Brake System
<b>Content</b>	<p><b>Issue:</b> ABS Diagnostic Trouble Code U0126-87 'Lost communication with Steering Angle Sensor' with no cause evident without any related customer symptoms.</p> <p><b>Cause:</b> Over sensitive DTC U0126-87 for ABS Module on V6 and V8 Petrol Supercharger Derivatives Only</p> <p><b>Action:</b> When using Symptom Driven Diagnostics (SDD) for diagnosis of a concern, if the DTC U0126-87 is found to be stored in the Anti-Lock Brake System Module with no related customer symptom, MIL or warning message, then continue without diagnosis of the U0126-87. Diagnose other stored DTCs as appropriate for the reported vehicle concern.</p>