

PREVOST

WARRANTY BULLETIN

WB14-44B

DATE :	SEPTEMBER 2014	SECTION :	06 - Electrical
EXPIRATION:	SEPTEMBER 2016		
SUBJECT :	VECU PARAMETERS CHANGE		
	<ul style="list-style-type: none">• Electrical Air Dryer Cut-Off Pressure & Desiccant Regeneration Factor		

REVISION : THIS WARRANTY BULLETIN SUPERSEDES PREVIOUS VERSION.

- B Warranty section modified. "We will reimburse you the parts and 3/4 hour..." changed for "We will reimburse you 3/4 hour..."
- A Former **Part 1 - DPF Temp Sensors T1, T2, T3 Rationality Check** removed from this bulletin. Vehicles Involved with former **Part 1** update will be corrected on a subsequent bulletin.

DESCRIPTION

On the vehicles affected by this bulletin, changing of VECU (Vehicle Electronic Control Unit) parameters is necessary.


This update must be carried out by qualified technicians. Make an appointment with your nearest Prevost Service Center.

ELECTRIC AIR DRYER CUT-OFF PRESSURE & DESICCANT REGENERATION FACTOR

This update involves all **OBD13 & GHG14** vehicles in service (refer to Application table for involved vehicles range).

This update will reduce air dryer cut-off pressure from 144 psi to 140 psi and extend desiccant regeneration time, thus preventing presence of water in the accessory tank.

APPLICATION – ELECTRIC AIR DRYER CUT-OFF PRESSURE & DESICCANT REGENERATION FACTOR

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevest website.</i>	
Model	VIN
H3-41, H3-45 coaches Model Year : 2013 - 2015	 <p>The following vehicles :</p> <p>2PCH3349XDC712146 2PCVS349XDC712248 2PCH33494DC712272</p>
H3-45 VIP motorhomes Model Year : 2014 - 2015	<p>And certain vehicles within the following range:</p> <p>From 2PCH33499DC712364 up to 2PCH33498FC712729 incl.</p>
X3-45 coaches Model Year : 2014 - 2015	<p>The following vehicles :</p> <p>2PCYS3492DC735374 2PCG33491DC735388 2PCG33492DC735433</p>
X3-45 VIP motorhomes And commercial use Model Year : 2014 - 2015	<p>And certain vehicles within the following range:</p> <p>From 2PCG33497EC735459 up to 2PCC33492FC735773 incl.</p>
<p>This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.</p>	

PROCEDURE

DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Connect Premium Tech Tool (PTT) to the vehicle diagnostics connector (OBD). Connect the PC to a functional LAN or modem connection and a 120 Volt AC source.
2. Turn the ignition switch "ON".
3. Once the vehicle has been identified and selected, perform Campaign S6991.

WARRANTY

This software update is covered by Prevest's normal warranty. We will reimburse you 3/4 hour (0.75) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevestcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB14-44".

OTHER

VBC Bulletin	S6991 (Part 2)
Fail Code	06.27-1
Defect Code	49
Syst.Cond.	B
Causal Part	3092091

Access all our Service Bulletins on
[https://secureus5.volvo.com/technicalpublications/
en/pub.asp](https://secureus5.volvo.com/technicalpublications/en/pub.asp)

or scan the QR-Code with your smart phone.

E-mail us at **technicalpublications_prev@volvo.com**
and type "ADD" in the subject to receive our warranty
bulletins by e-mail.

