

Date	Expiration	Release	Page
12.2014	12.2016	1	1(2)

Original release: This document supersedes previous revisions.

TRANSMISSION OIL COOLER BOLTS Prevost vehicles

DESCRIPTION

 
On the vehicles affected by this bulletin, inspect the transmission oil cooler to make sure it is properly secured. In certain material conditions, the bolts may extend beyond the threaded length of the mounting holes in the cooler creating a condition where the support is not tight on the cooler frame. Change the mounting bolts if required.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.	
Model	VIN
X3-45 Commuter Model Year : 2014	Single vehicles 2PCG33495 <u>EC735590</u> 2PCG33498 <u>EC735602</u>
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	

MATERIAL NEEDED

Order the following parts:

Part No.		Description	Qty
5001307		SCREW CAP HEXF M10-1.5x20 G10.9 N500	4

NOTE

Material can be obtained through regular channels.

PROCEDURE



Park vehicle safely, apply parking brake, stop engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

1. Lift vehicle
2. On the left side of transmission, check that the 4 mounting bolts on the oil cooler properly tighten the cooler on the support bracket.

Date	Expiration	Release	Page
12.2014	12.2016	1	2(2)

3. If play is present, change the four (4) mounting bolts for 5001307.



PARTS / WASTE DISPOSAL

Return replaced parts to Prevost with A.F.A. for full reimbursement.
Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately one hour.

OTHER

VBC Bulletin	N/A
Fail Code	07.01
Defect Code	09
System Condition	B
Causal Part	572043

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.