



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Service Engine Soon Light On DTC P0442

**Models:** 2013 - 2015 Cadillac ATS Sedan  
Built prior to 8/9/2014

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


### Condition/Concern

A customer may comment that they have a check engine light on

Upon further diagnostics, DTC P0442 - Evaporative Emission (EVAP) System Small Leak Detected may be set in the ECM.

### Recommendation/Instructions

Please check the fuel filler pocket rubber insulator to make sure it is not rolled over the fuel pipe neck as per the picture below.

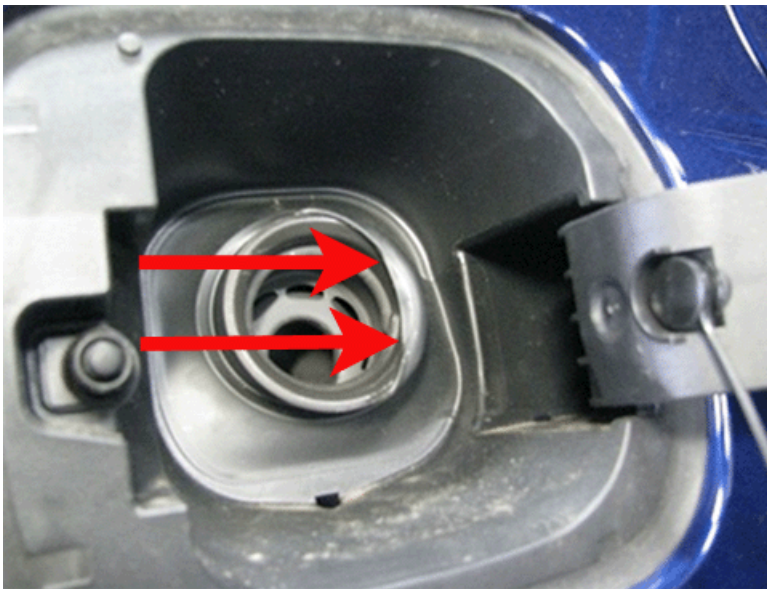

If the rubber is rolled over the filler neck, roll the rubber back over to the correct position. Check fuel filler cap to make sure the seal on the cap has not been damaged.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
1480358*	Check And Reposition The Fuel Filler Pocket Rubber Insulator	0.2 hr

\* This is an unique labor operation for bulletin use only. This will not be published in the Labor Time Guide.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION