



Service Bulletin

File in Section: -

Bulletin No.: PI0486B

Date: October, 2014

PRELIMINARY INFORMATION

Subject: Intermittent Clutch Pedal Low or Pedal Does Not Fully Return After Being Depressed

Models: 2010-2015 Chevrolet Camaro
Equipped with Manual Transmission (RPOs MV5, M10, MM6)

This PI has been revised to add the 2013-2015 Model Years and update the Parts and Warranty Information. Please discard PI0486A.

Condition/Concern

Some customers may comment on a low clutch pedal or that the clutch pedal does not fully return to the top after being depressed. This condition may be caused by imbalance in pressure forces due to thermal contraction of clutch fluid.

Important: This PI does not address pedal stick on the floor due to aggressive driving maneuvers, excessive clutch slip or low hydraulic fluid in brake fluid reservoir.

Recommendation/Instructions

Replace the clutch pedal assembly and transfer the original clutch pedal pad over. Refer to Clutch Pedal Replacement in SI.

Parts Information

Part Number	Description
22957491	Clutch Pedal

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8430060	Clutch Pedal Replacement	Use Published Labor Operation Time