



# Service Bulletin

File in Section: -

Bulletin No.: PI1341

Date: October, 2014

## PRELIMINARY INFORMATION

**Subject:** Cooled Seat Fan Making Tapping Noise When in Use

**Models:** 2014-2015 Chevrolet Impala (VIN 1)  
Equipped with Ventilated Driver and Passenger Front Seats (RPOs KU1, KU3)  
Built Prior to June 20, 2014

### Condition/Concern

Some customers may comment on a tapping noise heard when using cooled seats. This condition may be due to the seat cushion heat harness coming in contact with the cooling fan.

### Recommendation/Instructions



4002473

Re-route the seat cushion heat harness under the flex mat away from the cooling fan and attach a harness clip to the new location under the seat as shown above.

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7080168*	Re-routing the Seat Cushion Heat Harness Away From the Cooling Fan	0.4 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		