



Service Bulletin

File in Section: -

Bulletin No.: PI1092B

Date: October, 2014

PRELIMINARY INFORMATION

Subject: Rough Idle Concern

Models: 2013-2014 Cadillac ATS
Equipped with 2.5L Engine (RPO LCV)

This PI has been revised to update the Recommendation/Instructions.
Please discard PI1092A.

Condition/Concern

Some customers may comment on a rough idle when the engine is at operating temperature. The roughness is felt primarily in the seat of the vehicle.

Recommendation/Instructions (2013 Model Year)

Updated software calibrations (see table below) have been released to address this condition. Reprogram the ECM (Engine Control Module) and the FPCM (Fuel Pump Control Module). This is NOT a sequential programming event. Each module must be programmed separately.

These calibrations are only available through the Techline Customer Support Center (TCSC). Contact the TCSC at 1-800-828-6860 (English) or 1-800-503-3222 (French) for updated calibrations to reprogram the ECM and FPCM. Refer to the SPS reprogramming procedures in SI.

Recommendation/Instructions (2014 Model Year)

Updated software calibrations (see table below) have been released to address this condition. Reprogram the ECM (Engine Control Module) and the CCM (Chassis Control Module). This is NOT a sequential programming event. Each module must be programmed separately.

These calibrations are only available through the Techline Customer Support Center (TCSC). Contact the TCSC at 1-800-828-6860 (English) or 1-800-503-3222 (French) for updated calibrations to reprogram the ECM and CCM. Refer to the SPS reprogramming procedures in SI.

ECM Software P/N	FPCM Software P/N (2013 MY)	CCM Part Number (2014 MY)
12662391, 12662392, 12662393 or 12662394	23446837	23446838

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2880138*	Reprogram ECM and FPCM or CCM	0.5 hr

*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.