



Service Bulletin

PRELIMINARY INFORMATION

Subject: Diagnostic Tip: Battery, SES and/or Engine Oil Level Indicators On

Models: 2014 - 2015 Cadillac ATS
2014 - 2015 Chevrolet Impala
2013 - 2015 Chevrolet Malibu
equipped with 2.5L engine (RPO LCV or LKW)

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

During reassembly after a heavy engine repair it is very possible for a technician to accidentally switch the G13 generator X1 connector with the B35 engine oil level switch connector. Please refer to SI for connector endview for your specific vehicle to confirm. This oversight could cause the battery, SES or oil level MIL's to illuminate. P0621 may be set in the ECM.

Note: While the connectors are different they can easily be connected in the wrong location.

Recommendation/Instructions

Confirm and install connectors in proper location as needed.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION