



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Check Trailer Wiring Message and/or Service Trailer Brake With DTC C1114

**Models:** 2014 Chevrolet Silverado 1500  
2015 Chevrolet Silverado, Suburban, Tahoe  
2014 GMC Sierra 1500  
2015 GMC Sierra, Yukon Models

*This PI was superseded to update Recommendation/Instructions and Warranty Information. Please discard PIT5311.*

### Condition/Concern

Some customers may experience an intermittent "Check Trailer Wiring" message and/or a "Service Trailer Brake" message with DTC C1114 on vehicles equipped with ITBC (Integrated Trailer Brake Controller) RPO JL1. Below are two possible causes for these concerns.

**Note:** The below two possible causes can also effect a truck equipped with an aftermarket trailer brake controller.

1. These concerns may be displayed each time the trailer's running lamps, turn signal lamps, or brake lamps are turned on, especially if the trailer is equipped with a large number of lamps. This condition is most likely caused by insufficient trailer grounding and the trailer ground wiring will need to be repaired and/or upgraded.
2. These concerns could be caused by a poor connection at the 7-way trailer connector. There are several manufacturers of 7-way (trailer side) connectors and many do not comply with the SAE standard specifications. Some 7-way (trailer side) connector plugs may not properly engage the truck's 7-way connector socket and cause open circuits. Also, they may cause deformation and excessive wear of the terminals on the truck's 7-way connector socket. Over time, this will lead to poor terminal tension between the 7-way (trailer side) connector plug and the truck's 7-way connector socket. Since the Trailer Brake Control Module is always monitoring the vehicle and trailer circuits/components, a poor connection at the 7-way connector can cause a "Check Trailer Wiring" message on the DIC

### Recommendation/Instructions

1. Inspect and clean the ground wire (normally white wire) connection on the trailer side of the 7-pin connector.
  - Make sure that the wires inside the trailer side connector are clean and securely fastened.
  - If an electrical junction box exists on the trailer, make sure the wires inside the junction box are clean and securely fastened.
  - Once this procedure is complete, check to see if the condition has been corrected. If the condition still exists, perform the following procedure:
    - 1.1 Remove the original trailer ground wire (normally white wire) from the trailer side of the 7-pin trailer connector.
    - 1.2 Install a ring terminal (PN 12103512 located in Delphi Tray 18 or equivalent) to this wire and fasten the ring terminal to the metal or aluminum chassis of the trailer using an M6x1x20 self-taping phosphate zinc coated screw (PN 11609540 or equivalent).
      - Pre-drill trailer chassis location with a 3/16" hole.
      - Make sure the trailer chassis location is clean of paint or coating material prior to installation.
      - Galvanic corrosion between dissimilar trailer and screw metals may require that this ground location be periodically cleaned.
    - 1.3 Obtain a sufficient length of minimum 10 gauge (5.0 mm) white wire and fasten with ring (PN 12103512 or equivalent) terminal to the trailer chassis at the same location as the original ground wire.
    - 1.4 Install and fasten the other end of the new ground wire into the trailer side of the 7-pin trailer connector
    - 1.5 Install conduit on the original and new trailer ground wires and secure the conduit to the existing trailer harness.
2. Engineering has recommended the use of Pollak Heavy Duty 7-Way (Trailer Side) Connector Plugs. Pollak is the OEM manufacturer of the truck's 7-

way connector socket; by using a Pollak Heavy Duty 7-Way (Trailer Side) Connector Plug will ensure proper fit when the two connectors are mated. Pollak's website is: [www.pollakaftermarket.com/](http://www.pollakaftermarket.com/). Once at the home page select "Connectors" then "Heavy Duty 7-Way Plugs and Accessories" and then "RV Connectors Heavy Duty & Adaptors" (example 12-706, 12-702).

**Note:** If the truck's 7-way connector socket terminals are deformed or have excessive wear, it will be necessary to replace the truck side connector (with a GM CCA Customer Care and After sales Part) along with the trailer's 7-way connector plug to a Pollak HD.

## Warranty Information

No warranty labor operation is provided as the concern in this PI is related to a trailer issue.

---

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION