



Countries: CANADA, UNITED STATES, PUERTO RICO

Document ID: IK0800264

Availability: ISIS, FleetISIS

Revision: 2

Major System: ELECTRICAL SYSTEM

Created: 2/16/2011

Current Language: English

Last Modified: 3/5/2014

Other Languages: [Français](#), [Español](#),

Author: Joe Christopher

Viewed: 1000

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 57	 245

Title: Erratic rear lighting, water pump and back up alarm in combination

Applies To: eStar production

DESCRIPTION


Tail lights, water pump, backup alarm and box light do not operate properly.

SYMPTOMS

- The turn signal lights come on in place of running lights, turn signals do not indicate properly, the water pump works sporadically, the backup alarm sounds erratically if at all, backup lights do not work. All symptoms present at the same time.

TROUBLESHOOTING


- Locate the PG3 ground point located on the right hand rear of the chassis crossrail in front of the inverter and the high voltage inverter leads. It is best viewed looking upward toward the outer framerail from in front of the inverter. Use a long screwdriver or similar object to test the tightness of the ground by attempting to spin it.

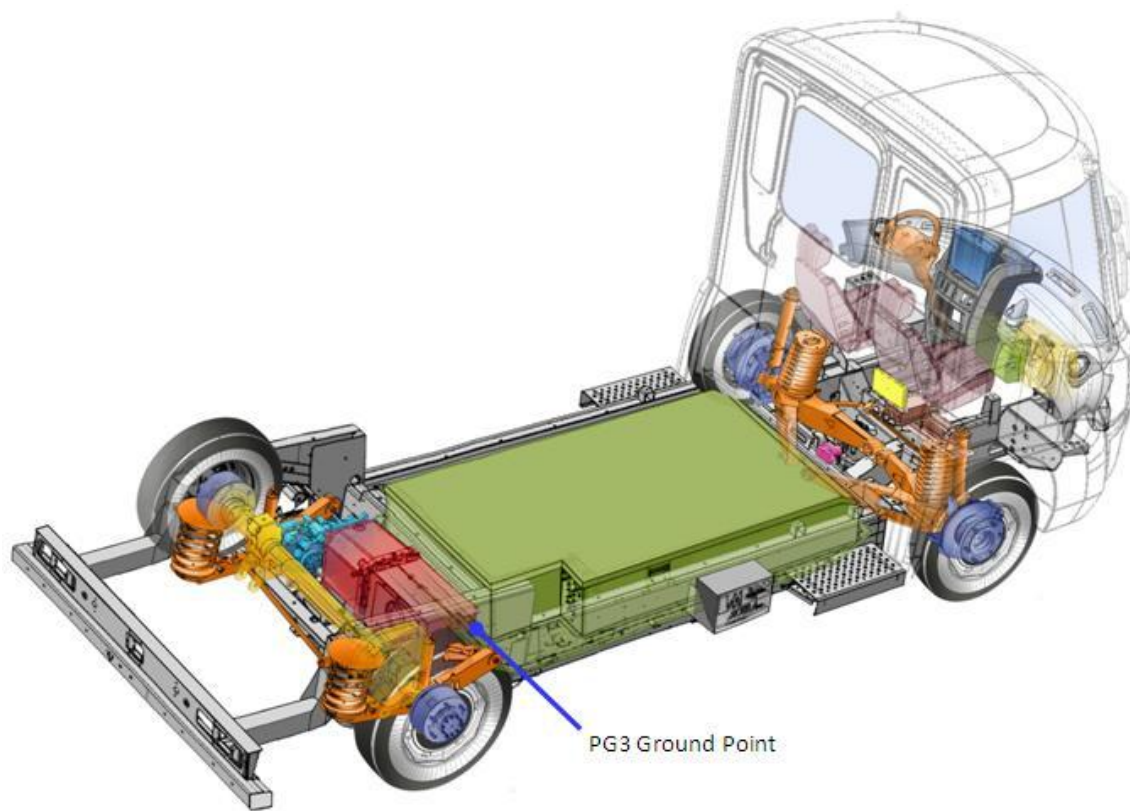

RESOLUTION

If the ground is loose use the appropriate tools to tighten the nut on the stud. Recheck for correct component operation.

OTHER RESOURCES

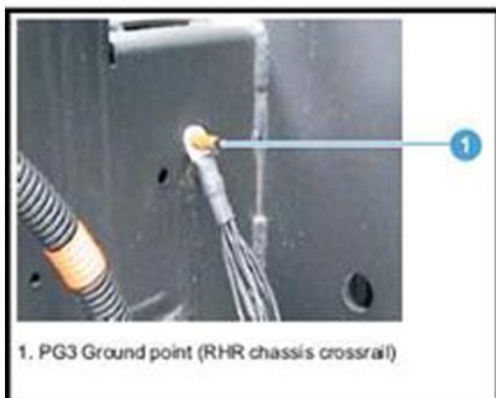

 Hide Details

Feedback Information

Viewed: 999

Helpful: 57

Not Helpful: 245

No Feedback Found

Copyright © 2014 Navistar, Inc.