



Countries:	CANADA, UNITED STATES, PUERTO RICO	Document ID:	IK1600067
Availability:	ISIS	Revision:	2
Major System:	CAB / SLEEPER / HOOD	Created:	10/16/2007
Current Language:	English	Last Modified:	3/12/2014
Other Languages:	Français , Español ,	Author:	Patrick Gotschall
Viewed:	153		

[Less Info](#)


Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 24	 28

Title: ProStar Work Surface Rattle


Applies To: ProStar

Issue:

Work surface rattle.

Repair:

- Remove small drawer located below work surface.
- Pull work surface fully open.
- If PVC spacer is not present, remove rubber detents located at the rear of work surface slides (Use x-mas tree removal tool if available). If PVC spacer is present remove PVC spacer located on latch.
- Cut a piece of silicone rubber hose (part number 2643493R1) to a length of 22mm (.87in) and install rubber spacer on latch.

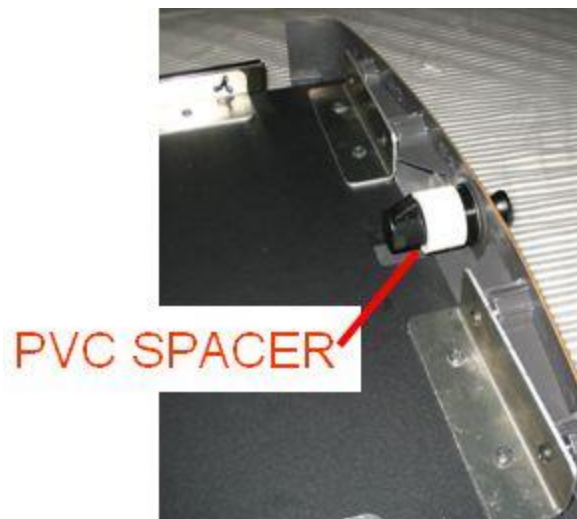

 Hide Details

Feedback Information

Viewed: 152

Helpful: 24

Not Helpful: 28

No Feedback Found



Copyright © 2014 Navistar, Inc.