



**Countries:** CANADA, UNITED STATES, PUERTO RICO  
**Document ID:** IK1600094  
**Availability:** ISIS  
**Revision:** 2  
**Major System:** CAB / SLEEPER / HOOD  
**Created:** 5/20/2008  
**Current Language:** English  
**Last Modified:** 3/12/2014  
**Other Languages:** [Français](#), [Español](#),  
**Author:** Patrick Gotschall  
**Viewed:** 176

[Less Info](#)

Hide Details

Coding Information

<b>Copy Link</b> 	<b>Copy Relative Link</b> 	<b>Bookmark</b>  <a href="#">View My Bookmarks</a>	<b>Add to Favorites</b> 	<b>Print</b> 	<b>Provide Feedback</b> 	<b>Helpful</b>  25	<b>Not Helpful</b>  42
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	------------------------------

**Title: 8600/TranStar Hood Latches Do Not Fit Correctly**

**Applies To: All 8600/TranStar models that have had the hood latches and/or the fender extensions replaced**

**DESCRIPTION**

All 8600/TranStar models that have had the hood latches and/or the fender extensions replaced

**SYMPTOMS**

Due to a design change to the hood latch and fender extension, the latch may be too loose OR too tight, depending on the age/revision level of the latch and/or fender extension.

**TROUBLESHOOTING**

Check to see if the hood latch is extremely difficult to latch or if it is extremely loose.

**RESOLUTION**

If there is a mismatch between the age/revision levels of the latch and fender extension and the latch is either too loose or too tight, new latch mounting holes must be drilled in the fender extension to change the position of the latch. If the latch is too tight, move the holes up 1/4" and if the latch is too loose, move the holes down 1/4".

Hide Details

Feedback Information

Viewed: 175  
 Helpful: 25  
 Not Helpful: 42

No Feedback Found



Copyright © 2014 Navistar, Inc.