

SERVICE ALERT

15MY COE TRUCK – DEF NOZZLE AND SIDE FUEL TANK INSPECTION

OVERVIEW


This service bulletin involves inspecting the DEF injector area for coolant leakage, nozzle connectors, shield, lines and side fuel tank (if equipped) for potential damage prior to signing off when receiving Hino trucks. The areas pictured below have been seen with damage. In the event that a subject truck is damaged, these parts would need to be repaired to correct this concern.

SUBJECT VEHICLES

2015 model year COE trucks.

INSPECTION PROCEDURE

1. Inspect the DEF injector area for coolant leakage, nozzle connectors, lines, and shield for potential damage and repair if necessary. Also, check the coolant level in the radiator and overflow bottle to be sure there is no coolant loss.

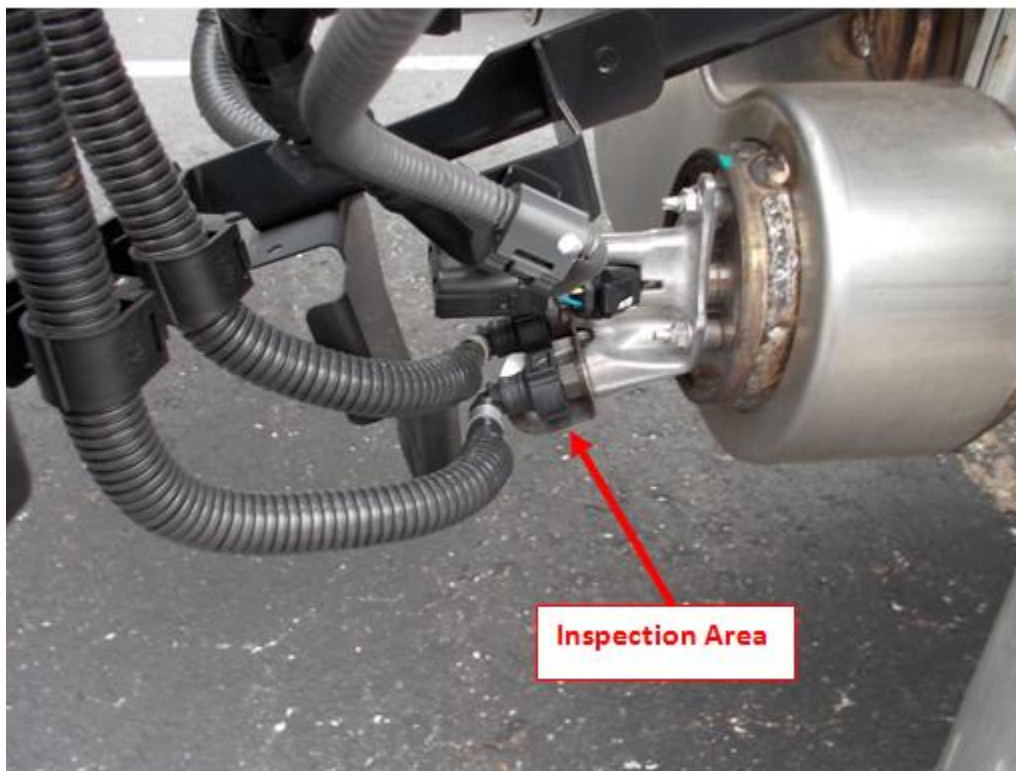

Group:	99-Miscellaneous
Bulletin No.:	SA-14-021
Issue Date:	09-23-2014

SERVICE ALERT

2. If equipped with a side fuel tank, inspect for potential damage and repair if necessary.



Note: This service bulletin is provided as information and is not authorization for a warrantable repair.