



Countries: BRAZIL, CANADA, COLOMBIA, UNITED STATES, MEXICO, PUERTO RICO
Availability: ISIS, Bus ISIS, FleetISIS
Major System: ENGINES
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 16649

Document ID: IK1200481
Revision: 5
Created: 4/2/2010
Last Modified: 6/5/2014
Author: David Horner

[Less Info](#)
[Hide Details](#)

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 2431	Not Helpful 1783
---------------	------------------------	---	----------------------	-----------	----------------------	---------------------	-------------------------

Title: Aftertreatment Soot Level Reset after AFI, DPF or DOC Cleaning or Replacement

Applies To: 2008 - 2009 MaxxForce® 11 and 13 Engines 2010-2012 MaxxForce® 11 and 13 Engines

DESCRIPTION:

The soot level accumulator must be reset in the After Treatment Control Module (ACM) when one of the following aftertreatment components have been cleaned or replaced:

- Diesel Particulate Filter (DPF) new or has been cleaned.
- Diesel Oxidation Catalyst (DOC) new or has been cleaned
- 2008 - 2009 MaxxForce 11 and 13 Engines Only - AFI cleaned or replaced

2008 - 2009 MaxxForce 11 and 13 SERVICE PROCEDURE:

After the DOC and/or the DPF been cleaned or replaced follow the process below to reset the soot level:

1. Connect ServiceMaxx® to the vehicle.
2. Top Menu Go to Sessions. Figure 1
3. Select Aftertreatment. Figure 1
4. Select HistoryTab Figure 2 -1
5. Select Parameter - Aftertreatment Reset Request Figure 2 -2
6. Use Chart 1 to make the proper reset choice based on component and action
7. Select the choice from the drop down in the value field next to the parameter name Figure 2- 3
8. Select Program Engine after the selected reset choice has been made. Figure 2-4

Chart 1

Component	Action	ServiceMaxx® Choice
Diesel Particulate Filter (DPF)	Cleaned	DPF Cleaned
After Treatment Fuel Injector (AFI)	Cleaned or Replaced	New or Cleaned AFT Fuel Injector
Diesel Particulate Filter (DPF)	New Replaced	New DPF Installed
Diesel Oxidation Catalyst (DOC)	New Replaced or Cleaned	New or Cleaned DOC



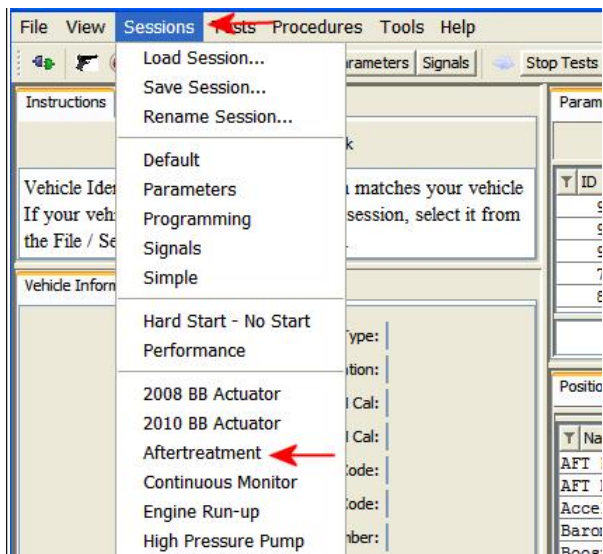


Figure 1 - Sessions - Aftertreatment

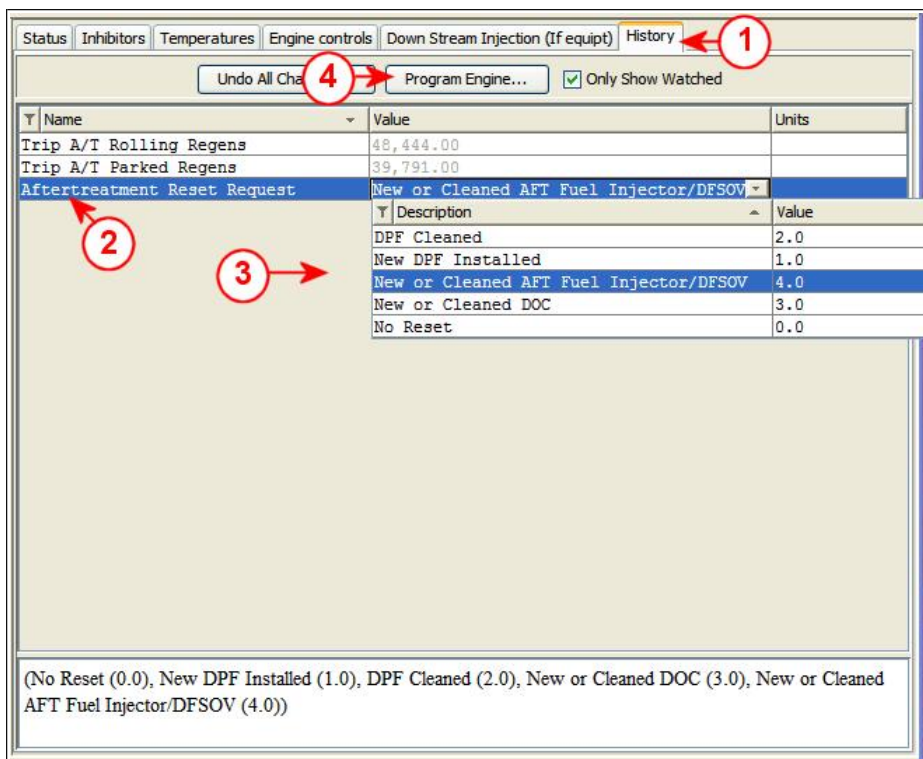


Figure 2 - Aftertreatment Session

- 1 - History Tab
- 2 - Aftertreatment Reset Request
- 3 - Select Reset Action
- 4 - Select Program Engine

2010 - 2012 MaxxForce 11 and 13 SERVICE PROCEDURE

After the DOC and or the DPF been cleaned or replaced follow the process below to reset the soot level:

1. Connect ServiceMaxx® to the vehicle.
2. Top Menu go to Sessions. -Figure 3
3. Select Programming. -Figure 3
4. Select Service Interval Tab -Figure 4
5. Select Parameter 95202 - Aftertreatment Reset Request - Figure 4
6. Select **DPF Replaced** Select the choice from the drop down in the value field next to the parameter name Figure 4
7. Select Parameter 66072 -DPF cleaning and installation date - Figure 5
8. Enter Replacement or Cleaning Date in the parameter field. - Format MM/DD/YYYY - Figure 5
9. Select **Program Engine** after the changes . Figure 5

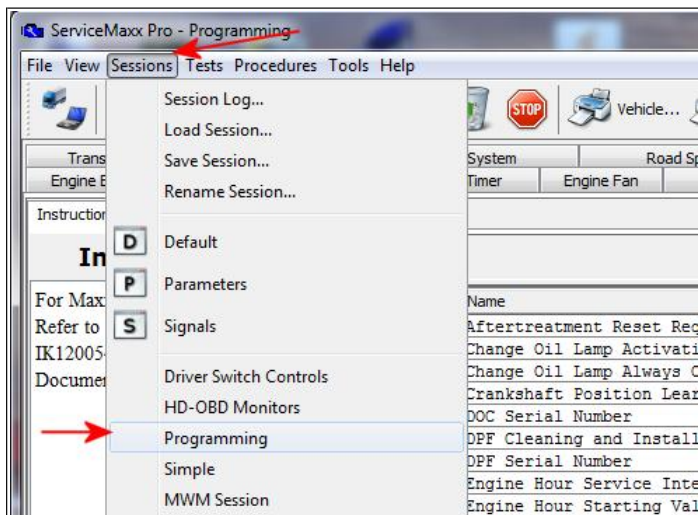


Figure 3 - Programming Session

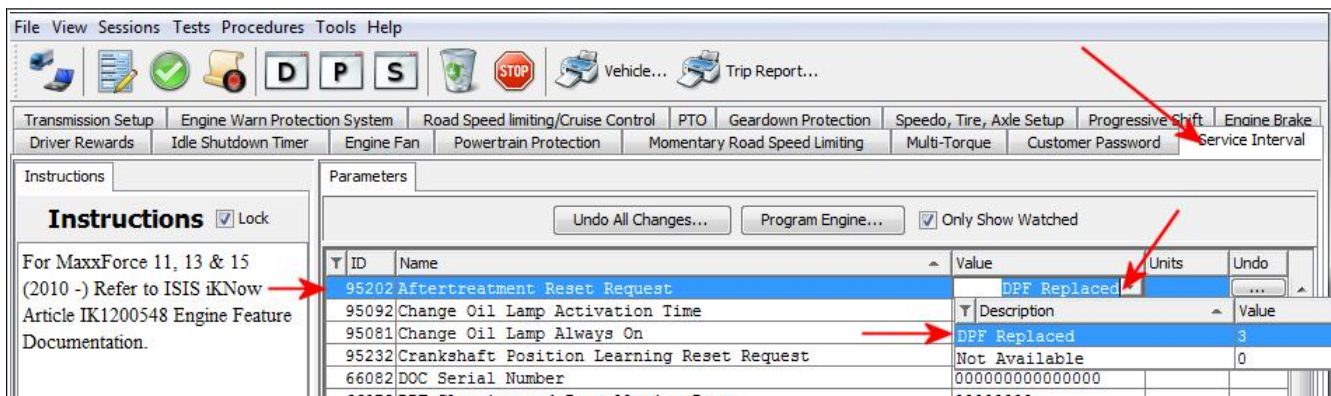
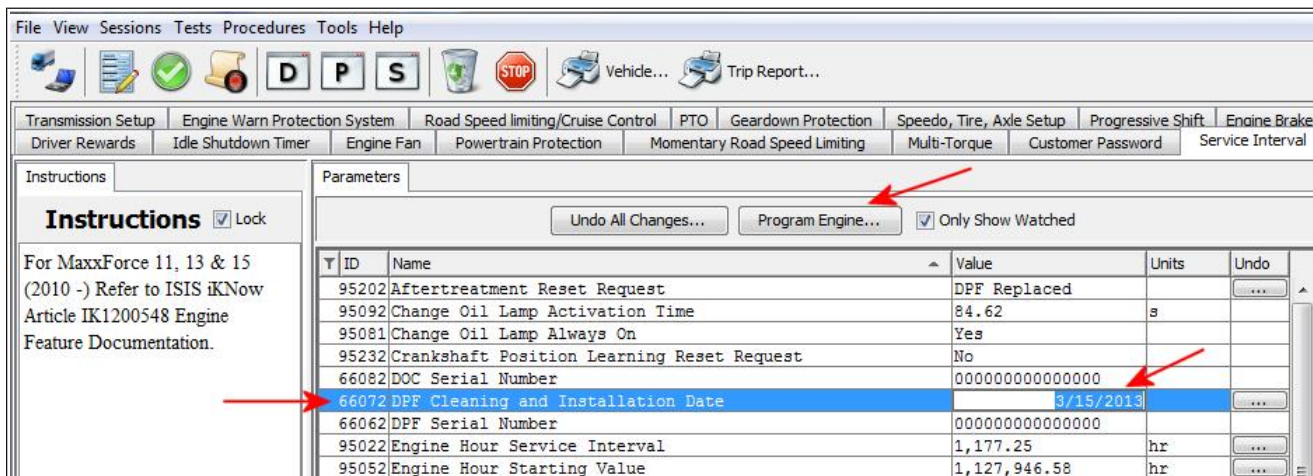
Figure 4 - Select Parameter 95202 Aftertreatment Reset Request
> DPF Replaced

Figure 5 - Select Parameter 66072 - DPF Cleaning and Installation Date

> Enter Cleaning or replacement Date
> Program Engine

 Hide Details

Feedback Information

Viewed: 16648

Helpful: 2431

Not Helpful: 1783

Staff ID	Client ID	Comments	Created Date
	DY03279	You received the following feedback From: dy03279 - Jacob Bos Email Address: jbos@itctrucks.com Job Classification: SE008, Service Technician Dealer: INTERSTATE TRUCK CENTER Feedback: We don't get the dpf replacement option in smaxx for 2010+ MXF11/13	6/5/2014 4:42:02 PM
	DY35478	You received the following feedback From: dy35478 - Steve Ziegler Email Address: steveziegler@selkinginternational.com Job Classification: SA003, Salesperson Dealer: SELKING INTERNATIONAL Feedback: For 2010-2012 MaxxForce 11/13, PP 95202 is not dealer level programmable in ServiceMaxx. It appears to be engineering only. What is the ramification of not being able to reset this since we have not been able to do it?	6/26/2014 2:08:03 PM

Copyright © 2014 Navistar, Inc.