

Technical Information

Service

41/14 ENU 9789

9


Replacing Pin on Power Distributor if the Power Distributor is Responsible for the Fault (41/14)

Vehicle Type: All 911 Carrera models (997)

All Boxster/Cayman models (987)

Model Year: As of 2005 up to 2012

Concerns: Power distributor (⇒ Installation position of power distributor)

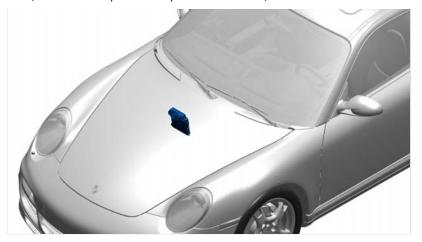


Installation position of power distributor

Information: In the event of complaints relating to the overall power supply on the vehicle and if a "corroded"

pin in the power distributor" is determined as the cause of the problem, the pin (⇒ Item 1 is old

style) must be replaced.

Complaints can include various malfunctions in the vehicle electrics (fault in PCM, failure of power windows or similar problems) or various error messages displayed in the instrument cluster.

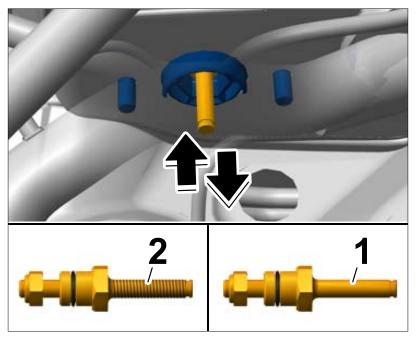

Item 1 is old style

Action Required: Replace the pin with a **new**, **modified pin (item 2)**, see Workshop Manual \Rightarrow Workshop Manual '978955 Replacing pins on the power distributor with screw bolts'.

Parts Info:

997.612.908.00 – NEW – \Rightarrow Repair kit containing: B+ line – pin with O-ring (sealing ring) – shrink-fit hose and mounting parts.

Invoicing:

The work involved is invoiced under the labor operation:

• 97895500: Replacing pin on power distributor

For invoicing and documentation using PQIS, specify "97890 – Power distributor" as the fault location (FES5) and "3313 – Corroded" as the damage category (SA4).

Technical Information Service 41/14 ENU 9789

References: ⇒ Workshop Manual '978955 Replacing pins on the power distributor with screw bolts'

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

Dealership	Service Manager	 Shop Foreman	 Service Technician	 	
Distribution					
Routing	Asst. Manager	 Warranty Admin.	 Service Technician	 	

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, 918 Spyder®, Tiptronic®, VarioCam®, PCM®, PDM®, 911®, RS®, 4S®, FOUR, UNCOMPROMISED®, and the model numbers and the distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. Specifications, performance standards, standard equipment, options, and other elements shown are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. The information contained herein is for internal authorized Porsche dealer use only and cannot be copied or distributed. Porsche recommends seat belt usage and observance of traffic laws at all times.