

Date	Expiration	Release	Page
04.2014	04.2016	1	1(4)

STEERING COLUMN COVER HARDWARE REPLACEMENT

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, the existing lower steering column cover hardware has to be replaced for improved fastening system.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS <i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
X3-45 Commuter Model Year : 2012	From 2PCG33495CC73 <u>5053</u> up to 2PCG33495CC73 <u>5232</u> incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	

MATERIAL NEEDED

Order the following parts:

Part No.	Description	Qty
500443	SCREW, TP PAN PH N500 #8x1/2	3
500855	WASHER, FL N500 .188x.438x.049	3
500684	NUT, SPRING 8A	3

NOTE
<i>Material can be obtained through regular channels.</i>

REQUIRED TOOLS

PHILLIPS SCREWDRIVER 	FLAT BLADE SCREWDRIVER 
--	--

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

- 1) In the driver's section, locate the steering column plastic cover at the bottom of the steering column (figure 1).

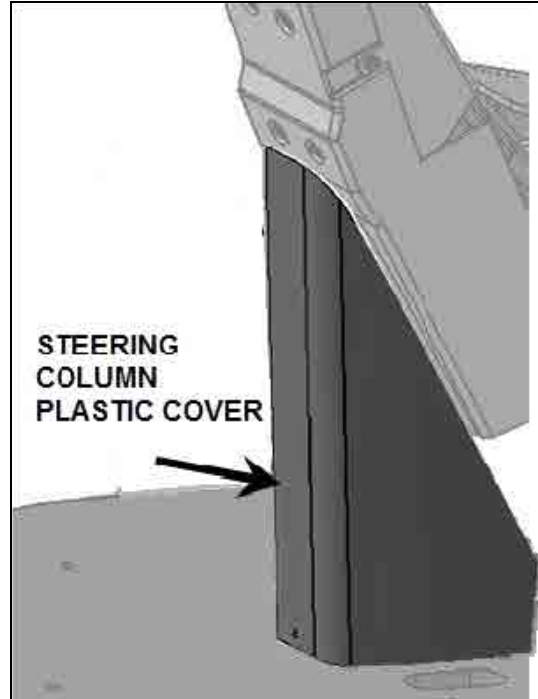


FIGURE 1

- 2) Using a flat blade screwdriver, remove the three (3) trim panel fasteners (a.k.a. Christmas tree fasteners) shown at the base of the plastic cover on figure 2.
- 3) Remove the plastic cover (figure 2).

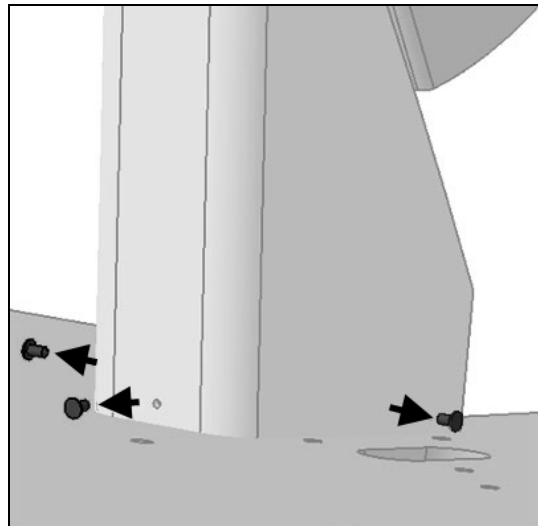


FIGURE 2

Date	Expiration	Release	Page
04.2014	04.2016	1	3(4)

- 4) Install three (3) spring nuts #500684 as shown at the three existing holes found on the base plate (figure 3, 4 & 5).

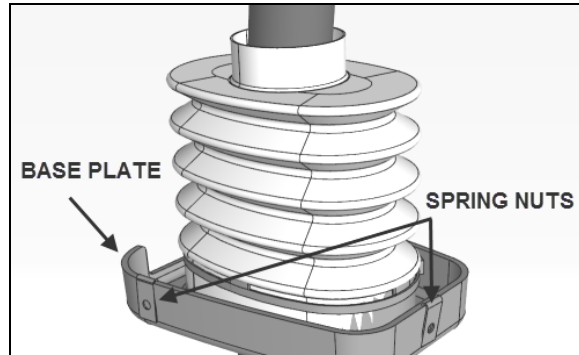


FIGURE 3 – L.H. AND FRONT SIDE

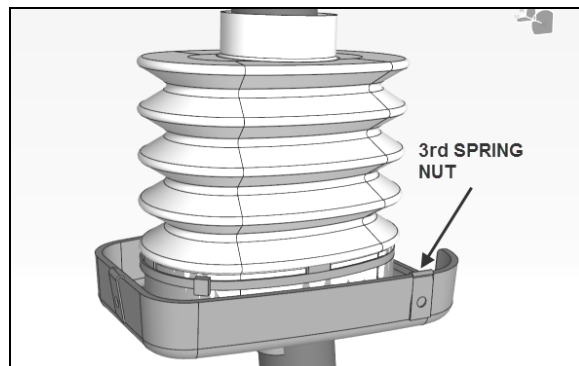


FIGURE 4 – R.H. SIDE

- 5) The tabs on the spring nuts must be located at the opposite side of the screw head (figure 5).

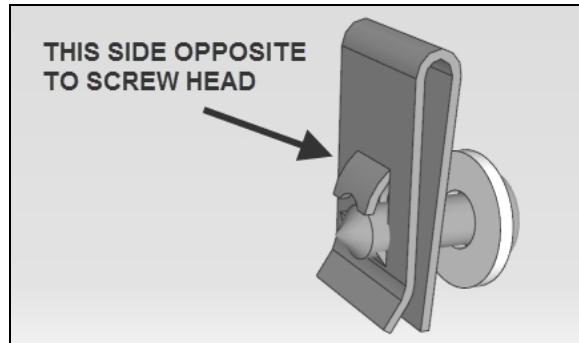


FIGURE 5

- 6) Reinstall the lower plastic cover, replacing each former trim panel fastener with:
1x screw #500443,
1x washer #500855

(see figure 6)

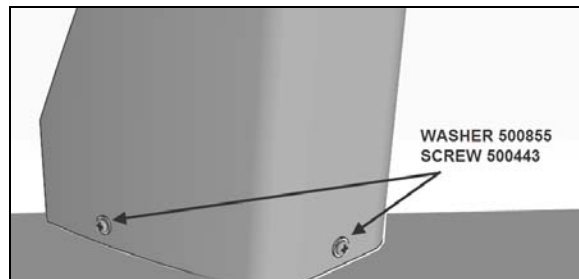


FIGURE 6 – 3rd FASTENING POINT NOT VISIBLE ON THE IMAGE

Date	Expiration	Release	Page
04.2014	04.2016	1	4(4)

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately 1/4 hour.

OTHER

VBC Bulletin	n/a
Fail Code	14.07
Defect Code	09
System Condition	B
Causal Part	504619

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.