

Technical Service Bulletin



01 MIL on (DTC P164B(00))

01 14 71 2036761/1 March 13, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
S4, S5, S6 Cabriolet, A6, A7, Q5, Q7	2011 - 2014	All	3.0 FSI

Condition

- MIL on.
- The following DTC is stored in the engine control module, J623 (address word 01):
 - **DTC P164B(00)** (Oil pressure switch malfunction).

Technical Background

The oil pressure switch is defective.

Production Solution

Updated oil pressure switch.

Service

1. Perform GFF test plan.
2. If GFF instructs to replace the oil pressure switch F22, use updated part number 06E919081G.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1705		
Damage Code:	0010		
Labor Operations:	Replace oil pressure switch	1705 19XX (See Elsa)	XX TU (See Elsa)
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 30 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB # 2036761/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part number	Part Description	Quantity
06E919081G	Oil pressure switch	1

Additional Information

All parts and service references provided in this TSB (2036761) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.