

97 No start (DTC P068A00)

97 14 42 2036764/2 March 31, 2014. Supersedes Technical Service Bulletin Group 97 number 14-41 dated March 18, 2014 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2009 - 2014	All	Not Applicable
A5	2009 - 2014	All	Not Applicable
A5 Cabriolet	2010 - 2014	All	Not Applicable
A6	2012 - 2014	All	Not Applicable
A7	2012 - 2014	All	Not Applicable
A8	2011 - 2014	All	Not Applicable
Q5	2009 - 2014	All	Not Applicable
Q7	2009 - 2014	All	Not Applicable
TT	2009 - 2014	All	Not Applicable

Condition

REVISION HISTORY				
Revision	Date	Purpose		
2	-	Revised <i>Production Solution</i> (Added solution) Revised <i>Service</i> (Added information about finding relay manufacturer) Revised <i>Warranty</i> (Updated battery labor operations) Added <i>Required Parts and Tools</i>		
1	03/18/2014	Initial publication		

- MIL on.
- Vehicle will not start.

© 2014 Audi of America, Inc.

- **DTC P068A00** is stored in the engine control module (ECM), J623 (address word 01).
- Numerous unrelated DTCs are also stored in the system, including: P056200, P057100, P068700, P068A00, P162400, P190C00, U010000, U010100, U012100, U014600, U015500, U021200, U101100, U102600, U111100, U111300, U140000, VAG00003, VAG00185, VAG00263, VAG00317, VAG00384, VAG00446, VAG00456, VAG00457, VAG00466, VAG00473, VAG00532, VAG00565, VAG00591, VAG00714, VAG00819, VAG00955, VAG01217, VAG01299, VAG01314, VAG01315, VAG01317, VAG01320, VAG01330, VAG01331, VAG01332, VAG01334, VAG01333, VAG01336, VAG01705, VAG01964, VAG02067, VAG02072, VAG02095, VAG02103, VAG02203, VAG02214, VAG02635, VAG02812, VAG02874, VAG03041, VAG03157, VAG03166, VAG03220, VAG03278, and/or VAG03531.

Page 1 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Background

The motronic engine control module power supply relay, J271, is not functioning properly. Because the J271 relay controls battery voltage (Terminal 30) via a ground signal sent from the ECM, numerous faults can occur in multiple control modules when it is not functioning properly.

Production Solution

Change of relay construction at Tyco Electronics. Installation of Hella relay in production.

Service

- 1. Confirm that DTC P068A00 is stored in the ECM, J623 (address word 01):
 - If DTC P068A00 is stored in the ECM, proceed with this bulletin.
 - If DTC P068A00 is not stored in the ECM, do not proceed with this bulletin. Continue with diagnosis.

Tip: The images used in this bulletin are of a 2014 A4 vehicle. Use Elsa to confirm component and connector terminal locations for the specific vehicle being repaired.

 Check Elsa for the location of the J271 relay (*Wiring diagrams* >> Component locations >> Component Locations: Relays) (Figure 1).

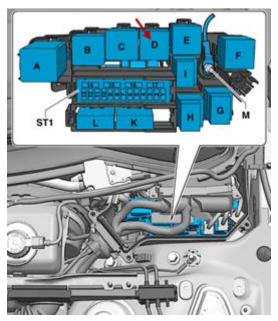


Figure 1. Location of J271 relay (D), as shown in Elsa.

© 2014 Audi of America, Inc.

Page 2 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



3. Remove the plenum cover (Figure 2).

Remove the washer reservoir filler neck

Remove screws to gain access to the

relay/fuse panel (Figure 4).

4.

5.

(Figure 3).

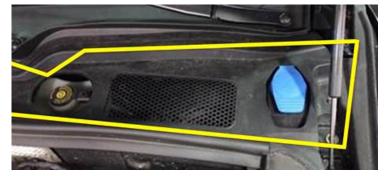


Figure 2. Plenum cover.

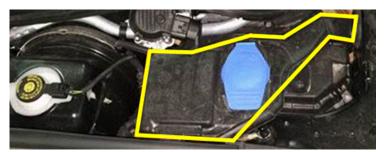


Figure 3. Washer reservoir filler neck.

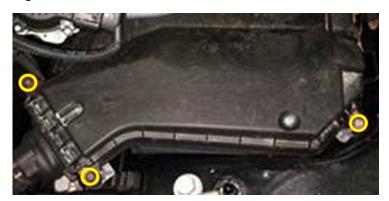


Figure 4. Screws to be removed (outlined).

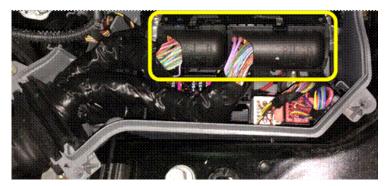


Figure 5. Engine control module (ECM).

Page 3 of 7

6. Remove the ECM (Figure 5).

© 2014 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



7. The J271 relay is now accessible (Figure 6).



Figure 6. J271 relay (outlined).

- 8. Check the relay manufacture build information on the relay. This information is printed under "645" on the relay:
 - If the relay is from Tyco Electronics and has a yellow label (Figure 7, 1), replace the relay and proceed to step 10.
 - If the relay is from Tyco Electronics and has a white label (Figure 7, 2) or from Hella and has a white label (Figure 7, 3), do not replace the relay. Proceed to step 9.



Figure 7. Relay manufacture data: Tyco Electronics relay with a yellow label (1), Tyco Electronics relay with a white label (2), Hella relay with a white label (3).

- 9. Check the J271 relay according to the instructions in Elsa at: Engine >> Generic Scan Tool >> ST Generic Scan Tool >> Diagnosis and Testing >> Diagnostic Procedures >> Engine Component Power Supply Relay, Checking.
- 10. Check for battery voltage on J271 relay terminals 1 and 3 (Figure 8).

If no voltage is found, do not proceed with this bulletin. Continue with diagnosis.

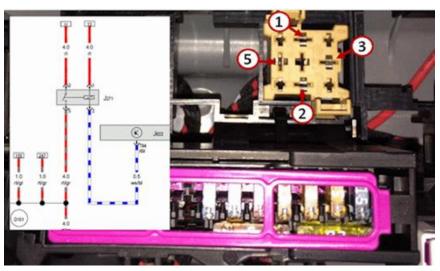


Figure 8. J271 relay terminals. Terminal 1: power from SA2, Terminal 2: switched ground from J623, Terminal 3: 30 power from SA2, and Terminal 5: switched power from J271.

Page 4 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



- 11. With the ECM disconnected, check the wiring from J271 relay terminal 2 to the ECM:
 - If voltage and wiring are good, replace the J271 relay.
 - If voltage and wiring are not good, do not proceed with this bulletin. Continue with diagnosis.

In the second se 2, it can damage the ECM.

- 12. After replacing the J271 relay, reinstall the ECM and confirm that the vehicle can be started. If vehicle cannot be started, continue with diagnosis.
- 13. Reinstall all components.
- 14. Check vehicle battery. Charge battery as needed before returning to customer.
- 15. Clear fault memory via ODIS GFF. Send diagnostic log via GFF Paperless.

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.			
Service Number:	2472			
Damage Code:	0010			
Labor Operations:	For A6 and A7:			
	Voltage relay remove + reinstall	2472 1950	10 TU	
	Cover remove + reinstall	8522 1900	20 TU	
	For A8:			
	Voltage relay remove + reinstall	2472 1999	10 TU	
	Central electrics cover remove + reinstall	9793 1900	40 TU	
	For Q7:			
	Voltage relay remove + reinstall (Includes Central electrics cover remove + reinstall)	2472 1900	30 TU	
	For A5 Cabriolet:			
	Voltage relay remove + reinstall	2472 1950	10 TU	
	Central electrics cover remove + reinstall (Includes cover remove + reinstall)	9793 1900	30 TU	

© 2014 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



	For TT:			
	Voltage relay remove + reinstall	2472 1900	20 TU	
	For A4:			
	Voltage relay remove + reinstall	2472 1950	10 TU	
	Central electrics cover remove + reinstall	9793 1900	30 TU	
	For Q5:			
	Voltage relay remove + reinstall	2472 1950	10 TU	
	Central electrics cover remove + reinstall	9793 1900	40 TU	
	For A5:		1	
	Voltage relay remove + reinstall	2472 1950	10 TU	
	Central electrics cover remove + reinstall	9793 1900	30 TU	
	Non BEM/BDM-equipped vehicles:			
	Battery check	2706 0150 (Q7 only)	10 TU (Q7 only)	
		2706 0100 (All others)	20 TU (All others)	
	Battery charge (If necessary - must be supported by battery test/charge logs)	2706 8950	10 TU	
	BEM/BDM-equipped vehicles:			
	Battery check	Included with GFF	Included with GFF	
	Battery charge (If necessary - must be supported by battery test/charge logs)	2706 8950	10 TU	
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 50 TU)	
	Road test prior to service procedure	No allowance	0 TU	
	Road test after service procedure	No allowance	0 TU	
	Technical diagnosis at dealer's discretion			
	(Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)			
Claim Comment:	As per TSB #2036764/2			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

© 2014 Audi of America, Inc.

Page 6 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Required Parts and Tools

Part Number	Part Description	Quantity
4H0951253A	Relay	1

Additional Information

All parts and service references provided in this TSB (2036764) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2014 Audi of America, Inc.

Page 7 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.