

Technical Service Bulletin



55 DTC 03541 stored in rear lid electronics control module

55 14 35 2037951/1 July 28, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5	2015	009869 - 012208	Not Applicable

Condition

DTC 03541 (Rear lid control module 2, EEPROM malfunction) is stored in the rear lid electronics control module (address word 6D). ODIS is unable to clear the fault.

Technical Background

There is a software check error between right and left rear lid control modules.

Production Solution

The wiring memory of EEPROM for the rear lid electronics control module has been corrected.

Service

If **DTC 03541** is found, check the rear lift gate to ensure that it is opening and closing correctly. If it performs without malfunction, ignore the DTC and do not perform any repairs or replace any parts.

Warranty

This TSB is informational only and is not applicable to any Audi warranty.

Additional Information

All parts and service references provided in this TSB (2037951) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.