

1 8 01-14



Service Information Bulletin

SUBJECT	DATE
SPN 524275 (CPC) (GHG14)	August 2014

Additions, Revisions, or Updates

Publication Number / Title	Platform	Section Title	Change
DDC-SVC-MAN-0084	GHG14 DD Platform	SPN 524275/FMI 19 - GHG14	This is a new section.



13400 Outer Drive, West, Detroit, Michigan 48239-4001
 Telephone: 313-592-5000
www.demanddetroit.com

2 SPN 524275/FMI 19 - GHG14

RCM Message Not Received or Stopped Arriving

Check as follows:

NOTE: This fault code is not calibrated for NAFTA Market. If this fault code is active, the Common Powertrain Controller (CPC) parameter set is wrong.

1. Connect DiagnosticLink[®].
2. Check for proper configuration of the CPC against the server information. Does the CPC have the proper configuration?
 - a. Yes; replace the CPC. Refer to Original Equipment Manufacturer (OEM) literature.
 - b. No; reprogram the CPC with the correct information as necessary. Go to step 3 to verify repair.
3. Clear fault codes. Turn ignition OFF and disconnect DiagnosticLink. Wait five minutes for all modules to power down. Verify repair.