

Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, GTI, Jetta SportWagen	2010 - 2014	All	All	All	All
Jetta Sedan	2011 - 2014	All	All	All	All
Passat	2012 – 2014	All	All	All	All

Condition

69 14 02 March 26, 2014 **2029767** Supersedes Technical Bulletin V691301 dated February 11, 2013 to include additional model year applicability.

Airbag Warning Lamp Illuminated in Instrument Cluster, DTC B101614 Stored in Airbag Control Module

Technical Background

Airbag lamp in instrument cluster may illuminate due to unfastened connector for passenger airbag warning lamp.



Symptom as described will not affect airbag functionality.

Production Solution

Information only.

Dos Auto

Technical Bulletin

Service

Procedure

- Verify airbag indicator lamp in instrument cluster is ON.
- Using GFF, scan vehicle for DTCs.
- Verify DTC B101614 is stored in airbag module.

Fault Code	Description	
	Front passenger airbag disabled indicator lamp interruption/short - circuit to ground	



If any other faults are present in airbag module, further diagnosis is required.

- If DTC is present, clear fault memory and recheck for code.
- If fault clears, and the airbag indicator in the instrument cluster does not illuminate, no repairs necessary.
- If DTC reoccurs, remove center console cover using wedge tool 3409, inspect wiring connections to "PASSENGER AIR BAG WARNING LAMP" (see figures 3 and 4), for loose connection.
- Secure wiring connections as necessary.
- If connection is secure, further diagnosis is needed. This technical bulletin does not apply.
- Clear DTCs again and retest operation to verify airbag lamp is OFF in instrument cluster.



Figure 1

No - Climatronic

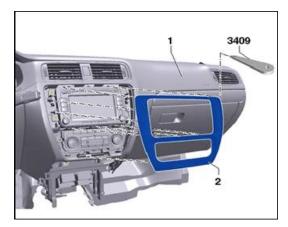


Figure 2

Climatronic

(W)

Technical Bulletin





Figure 3 Figure 4

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual 1) Model(s) Year(s) Eng. Code(s) Trans. Code(s) **VIN Range From VIN Range To** Golf, GTI, Jetta ΑII 2010 - 2014 ΑII ΑII ΑII **SportWagen** Jetta Sedan 2011 - 2014 ΑII ΑII ΑII ΑII **Passat** 2012 - 2014 ΑII ΑII ΑII ΑII **SAGA Coding** Use applicable Claim Type 1) Claim Type: **Damage** Service Damage Location (Depends on **HST** Number: Service No.) Code Use applicable when indicated 6982 0015 in ElsaWeb (L/R) WWO 2) Golf, GTI **Parts** Jetta Sedan, Jetta SportWagen 3ME 2) Manufacturer TX6²⁾ **Passat**



Technical Bulletin

Labor Operation ^{3):} Remove console trim, reconnect pas lamp harness connector.		69824199 = 20 TU (loose connection found)	
Causal Part: Select labor op	eration	69824199	
	Diagno	ostic Time ⁴⁾	
GFF Time expenditure	01500000 = 20 T	U max.	YES
Road Test	01210002 = 00 T 01210004 = 00 T		NO
Technical Diagnosis	01320000 = 00 T	U max.	NO

Claim Comment: Input "As per Technical Bulletin 2029767" in comment section of Warranty Claim.

Required Parts and Tools

No special parts required.

Tool Description	Tool No:	
Wedge Tool	3409	
Midtronics Battery Tester/Charger	InCharge 940 (INC-940)	
VAS Diagnostic Tool	VAS 5051B, VAS 5052A, VAS 6150/X & VAS 6160/X with:	
	ODIS Service 2.0.0 or higher with current online updates	

¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only

²⁾ Code per warranty vendor code policy.

³⁾ Labor Time Units (TUs) are subject to change with ELSA updates.

⁴⁾ Documentation required per Warranty Policy Procedures Manual.



Technical Bulletin

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.