

91 Night vision system inoperative (DTC for control unit faulty)

91 14 68 2038860/1 October 30, 2014.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2015	000001 - 017013	Night vision assistant (PR 9R1)

Condition

- The night vision system is intermittently inoperative (a warning message appears in instrument cluster and no night vision display is available).
- One of the following DTCs is stored in the night vision system control module, J853 (address word 84):
 - DTC B200005 (Control module faulty)
 - DTCB200047 (Control module faulty)
 - DTC B2000F2 (Control module faulty)

Technical Background

Incorrect software in the night vision system control module.

Production Solution

Optimized software in the night vision system control module.

Service

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Update the night vision control module (J853) using the SVM action code as listed in the table below, if necessary.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
40.00	4G0907547	0023	1000075171	0407	044004
A8, S8	4G0907547A	0105	4G0907547A	0107	84A001

^{© 2014} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.					
Service Number:	9081					
Damage Code:	0039					
Labor Operations:	Update software (includes check/clear codes)	9081 2599	Time stated on diagnostic protocol (Max 60 TU)			
	OR					
	Check software of might vision control module	9081 0199	20 TU			
Diagnostic Time:	GFF	No allowance	0 TU			
	Road test prior to service procedure	No allowance	0 TU			
	Road test after service procedure	0121 0004	10 TU			
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)					
Claim Comment:	t: As per TSB #2038860/1					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2038860) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2014 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.