

# Technical Service Bulletin



## 85 Lack of heating or air conditioning

85 14 22 2033596/4 November 11, 2014. Supersedes Technical Service Bulletin Group 85 number 14-20 dated February 24, 2014 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2009 - 2013	000001 - 999999	Not Applicable
A4	2014	A000001 - A079695 N000001 - N023000	Not Applicable
A5	2008 - 2013	000001 - 999999	Not Applicable
A5	2014	A000001 - A037615 A900000 - A901210	Not Applicable
Q5	2009 - 2013	000001 - 999999	Not Applicable
Q5	2014	000001 - 060911	Not Applicable
A5 Cabriolet	2010 - 2013	000001 - 999999	Not Applicable
A5 Cabriolet	2014	N000001 - N006000 N900000 - N900583	Not Applicable

## Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised <i>Required Parts and Tools</i> (Modified Part Number)
3	2/24/2014	Revised header data (Added model years)
2	5/15/2013	Revised <i>Condition</i> (Modified DTCs) Revised <i>Service</i> (Modified DTCs) Modified title
1	4/19/2013	Initial publication

One or more of the following DTCs may be stored in the heating and air conditioning electronics control module (address word 08):

- DTC 01844 004
- DTC 01844 014
- DTC 01273 009

- DTC 01273 006

## Technical Background

Improper operation of the fresh air blower could be caused by one or both of the following root causes:

- A faulty printed circuit board in the fresh air blower control module, J126.
- The carbon brushes bind in the brush holder and, as a consequence, lose contact with the motor commutator of the fresh air blower, -V2-.

## Production Solution

- Improved fresh air blower control module, J126.
- Improved brush assembly has been implemented in production.

## Service

If either of the following DTCs are present, replace the fresh air blower control module, J126:

- DTC 01844 004
- DTC 01844 014

-OR-

If either of the following DTCs are present, replace the fresh air blower, -V2-:

- DTC 01273 009
- DTC 01273 006

If DTCs for both the J126 as well as the V2 are present, replace both the fresh air blower control module, J126 and the fresh air blower, -V2-.

# Technical Service Bulletin



## Warranty

<b>Claim Type:</b>	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	8530		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Blower remove and reinstall	8530 1900	70 TU
	-or-		
	Blower regulator remove and reinstall	8778 1900	70 TU
<b>Diagnostic Time:</b>	GFF	0150 0000	Time stated on diagnostic protocol (Max 30 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2033596/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Part Number	Part Description	Quantity
Use applicable part number specified by VIN in ETKA.	Fan	1
-OR-		
Use applicable part number specified by VIN in ETKA.	Blower control	1



## Additional Information

All parts and service references provided in this TSB (2033596) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.