

Technical Service Bulletin



01 MIL on (DTC P010600 - Manifold Abs.Pressure or Bar.Pressure Range/Performance G71/-F96 - implausible signal)

01 14 67 2028445/3 February 19, 2014. Supersedes Technical Service Bulletin Group 01 number 13-43 dated November 26, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2010 - 2012	All	4.2 FSI

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header data (Added customer codes)
2	11/26/2013	Revised title Revised header data (Added DTC) Revised <i>Service</i> (Updated SVM code)
1	1/25/2012	Initial publication

- MIL on, often illuminating at temperatures below 0°C/32°F.
- The following DTC is store in the engine control module, J623 (address word 01):
 - **DTC P010600:** Manifold Abs.Pressure or Bar.Pressure Range/Performance G71/-F96 - implausible signal

Technical Background

Optimized software in the engine control module.

Production Solution

New software in engine control module addressed the condition.

Technical Service Bulletin



Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732, *00 Software Version Management (SVM), operating instructions*.
2. Update the engine control unit, J623, using the SVM action code as listed in the table below if necessary.

Model	Engine	Old Software Part Number	Old Software Version (or lower)	New Software Part Number	New Software Version (or higher)	SVM Action Code
A8	4.2FSI	4H0907560A	All	4H0907560C	0005	01A155
A8	4.2FSI	4H0907560C	All			

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Check software levels, no update necessary	2470 0199	20 TU
	Check software level, perform update	2470 2599	40 TU
Diagnostic Time:	GFF – checking and clearing fault codes is included in existing labor operations	No allowance	0 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2028445/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Description	Quantity
Approved battery charger	1

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (2028445) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.