



Service Bulletin

PRELIMINARY INFORMATION

Subject: Unwanted Trunk Opening

Models: 2013 Cadillac XTS

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer may comment after returning to their parked vehicle the trunk lid is open unwantedly.

Recommendation/Instructions

A new calibration has been added to the BCM program to increase the hold time of the fob trunk button from 200ms to 1000ms press. Please confirm the trunk release Fob button timing has not already been modified (from 200ms to 1000ms) before programming BCM strictly for this concern.

If the trunk opens after a 200ms press of the fob button, please program the BCM using SPS programming and advise the customer that the trunk button now requires a 1 second press and hold to open the deck lid. Reference the Body Control Module Programming and Setup section of SI.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION