



Countries: CANADA, UNITED STATES, MEXICO, PUERTO RICO
Availability: ISIS
Major System: ENGINES
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 3136

Document ID: IK1200099
Revision: 4
Created: 5/21/2007
Last Modified: 2/11/2014
Author: Ryan Hendrickson

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 640	 825

Title: Maxxforce 10 DT Code 1113, 1135, 1134 or 1112 ECM / IDM Power (Clean Power Fuses Blowing) or APS codes

Applies To: Maxxforce 10 DT

DESCRIPTION

If you find the ECM or IDM clean power fuses in the battery box blown, check the ECM and IDM power relays and the wiring to them. ECM and Actuator power relays are zip tied to engine harness on left side of engine. The wires could possibly rub against the ITV and cause a short. See pictures below.

Possible DTC's

1112, 1113, 1135, 1134

Conditions This Will Cause:

- If the IDM loses power, it will crank, but not start and you'll get a DTC 1113
- IF the ECM loses power, the engine will start, but you won't have any throttle.





Hide Details

Feedback Information

Viewed: 3135

Helpful: 640

Not Helpful: 825

No Feedback Found

Copyright © 2014 Navistar, Inc.