



Countries: CANADA, UNITED STATES, MEXICO, PUERTO RICO
Availability: ISIS, Bus ISIS, FleetISIS
Major System: ENGINES
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 24021

Document ID: IK1200478
Revision: 7
Created: 3/23/2010
Last Modified: 2/12/2014
Author: Robert Beckett

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		View My Bookmarks				2732	1474

Title: On vehicle DOC Cleaning MaxxForce® 7 Engines**Applies To:** 2007 - 2009 MaxxForce® 7,

Note:

When the ECM calibration is updated the (parameter 87002) Customer Password (CPW) is restored to Calibration default (0000). You will need to acquire the CPW and program it back in when finished with the update. The only exception to this is if the ECM is updated with NETS and we have the CPW saved in our database, then the CPW will be programmed back into the ECM during a cal update. If this happens, see the note on step 11 of this article.

DESCRIPTION

A method to clean the DOC on the vehicle with ServiceMaxx in combination with ZTSE 6031 has been developed. A partially plugged DOC may cause excessive Exhaust Back Pressure and cause a rise in engine oil level due to fuel dilution.

SYMPTOMS

- Loss of power
- Excessive regens
- Unable to regen
- Rise in oil level
- High exhaust back pressure

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
2352	ECM	EBP above desired level

SERVICE PROCEDURE

**WARNING:**

To prevent unexpected movement of the vehicle and possible serious personal injury or death, park the vehicle on a flat, level surface, set the parking brake, turn the engine off and chock the wheels to prevent vehicle from moving in both directions.

**WARNING:**

To avoid personal injury from the muffler and exhaust system allow the vehicle to cool sufficiently before servicing the muffler and exhaust system.

Maintain adequate clearance between all parts of the exhaust system and all hoses, wires and lines for engine cooling, brake system, fuel system, power steering system and electrical system. Ensure that all components near the exhaust system are free of oil or other flammable debris. If the heat from DOC cleaning accumulates to certain amount near the exhaust system, it may set nearby items on fire and result in property damage, personal injury or death.

1.

move the three M10 X 50 flange bolts at the rear of the DPF.

2. Insert Restrictor plate torque bolts to 40 lbf-ft. (School Bus and horizontal tailpipe only) See Photo 1

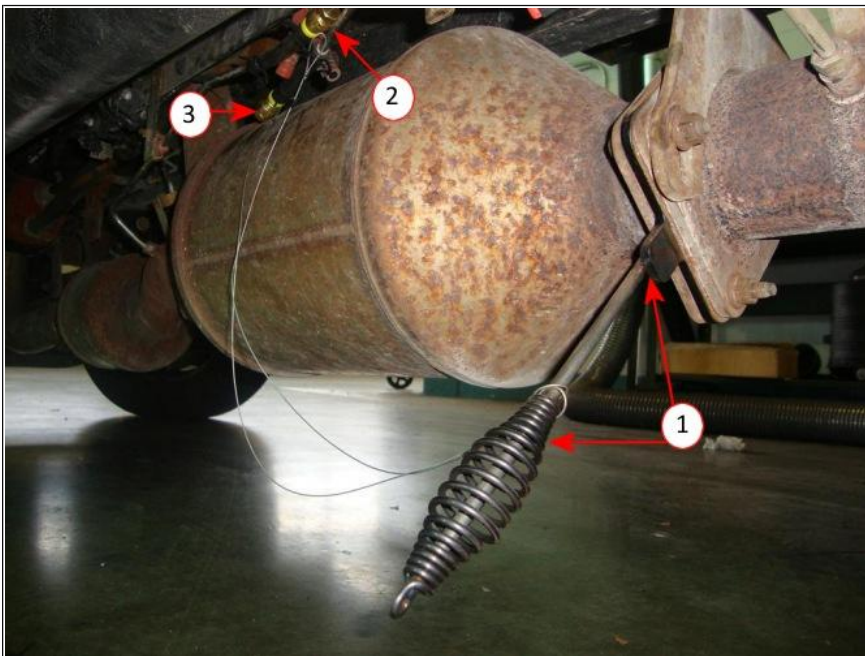


Photo 1 - Restrictor Installed - Horizontal Exhaust

- 1. Restrictor Tool
- 2. EGDH Hose Plug
- 3. EGDH Hose Plug

3. For Vertical Exhaust install Restrictor Cap as shown in Photo 2 - Tighten clamps bolts to 60 ft. lbs.

CAUTION :

UPDATE! A tool modification kit for ZTSE6031 was shipped to all dealers in May 2011. ZTSE6031 should ONLY be used AFTER this modification has been completed.

Additional information- <https://evaluate.internationaldelivers.com/service/sfnpdf/IT11-126.pdf>
and https://evaluate.internationaldelivers.com/service/sfns/sfn1042_1.xml



Photo 2 - Vertical Exhaust Restrictor- **Chain must be taut and securely attached at the bottom**

4. Disconnect both the EGDP tubes from the rubber hose at the EGDP Sensor
5. Install the 2 EGDP Plugs and hoses supplied with tool kit. See Photo 3



Photo 3 - EGDP Plugs and Hoses Installed on Steel EGDP Tubes
EGDP Plug
EGDP Plug
Original hoses to EGDP Sensor disconnected

6. Move vehicle outside and away from activity.
7. Ensure Parking Brake is set.
8. Open hood


**WARNING:**

To prevent unexpected movement of the vehicle and possible serious personal injury or death, park the vehicle on a flat, level surface, set the parking brake, turn the engine off and chock the wheels to prevent vehicle from moving in both directions.

**WARNING:**


Open hood during on-vehicle DOC cleaning. This can greatly reduce the effects of heat on hoses, wiring and other components near the exhaust system. If the heat from DOC cleaning accumulates to certain amount near the exhaust system, it may set nearby items on fire and result in property damage, personal injury or death

9. Connect ServiceMaxx and Key On
10. ServiceMaxx menu click "Procedures "
11. Scroll down to Aftertreatment Procedures than click "DOC Cleaning procedure." See Below

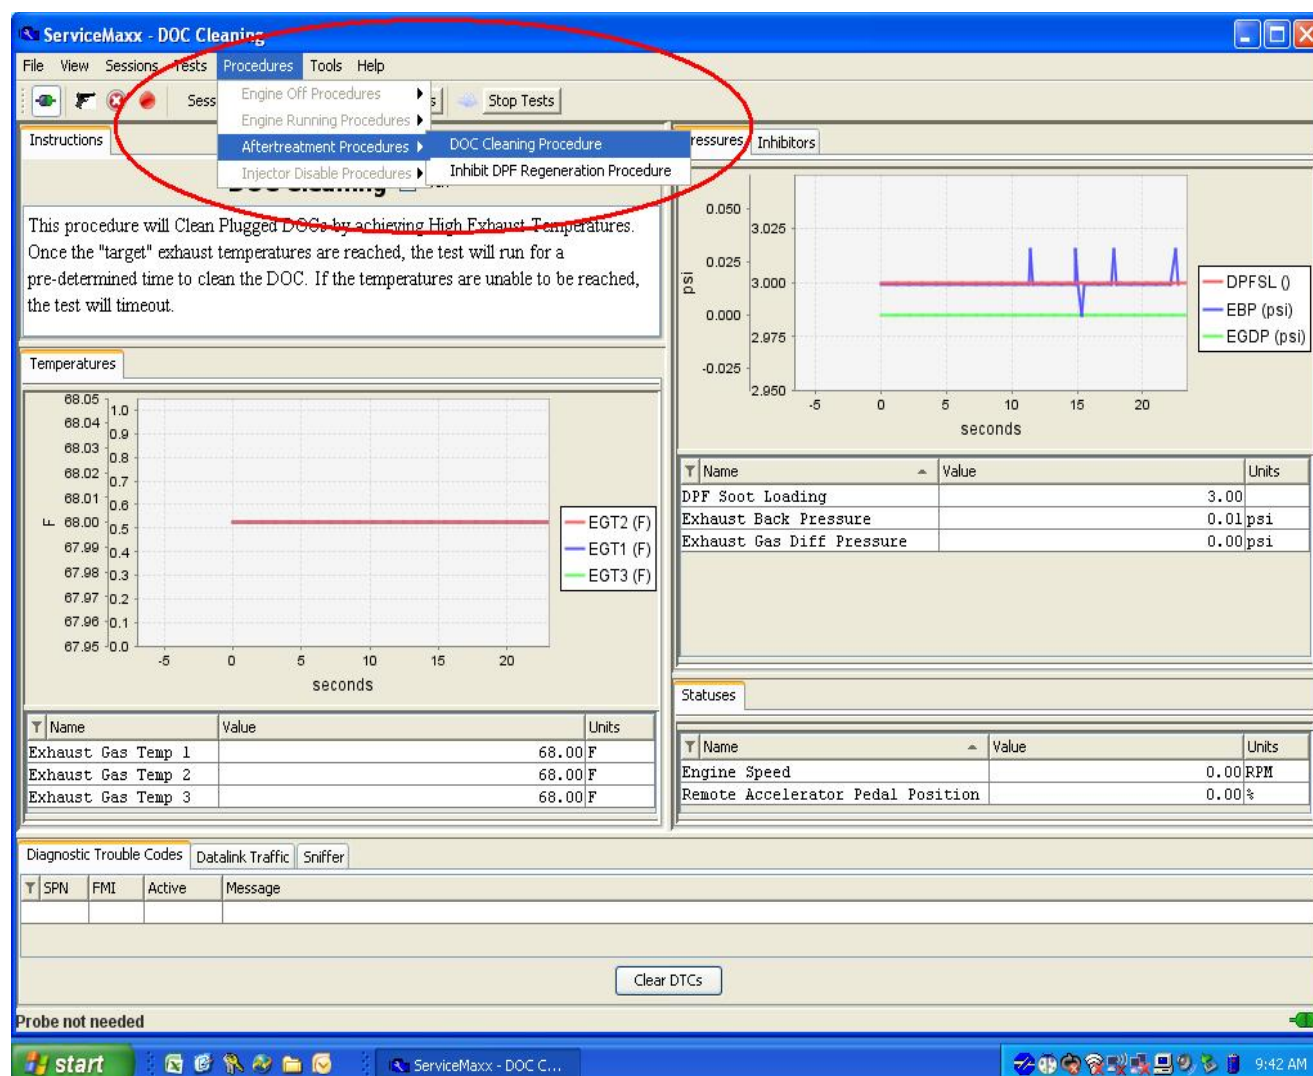

12. ServiceMaxx will now load parameters required to run the procedure. This may take a few moments.


Note: During steps 10-11 of the procedure if the message displayed below appears there is a customer password present in this vehicle.

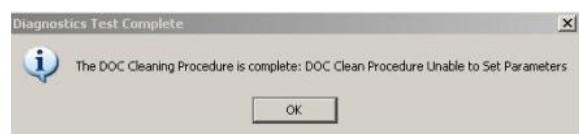

You will need the customer password to move forward. Change the password (parameter 87002) to 0000, run the procedure and then program the customer password back into the engine when the procedure is complete. If the customer password is unavailable please contact tech central.


13. DTC 2352 and 1213 may set ignore these DTC codes.

14. After Reading the Pre-test information click "Ok". See below

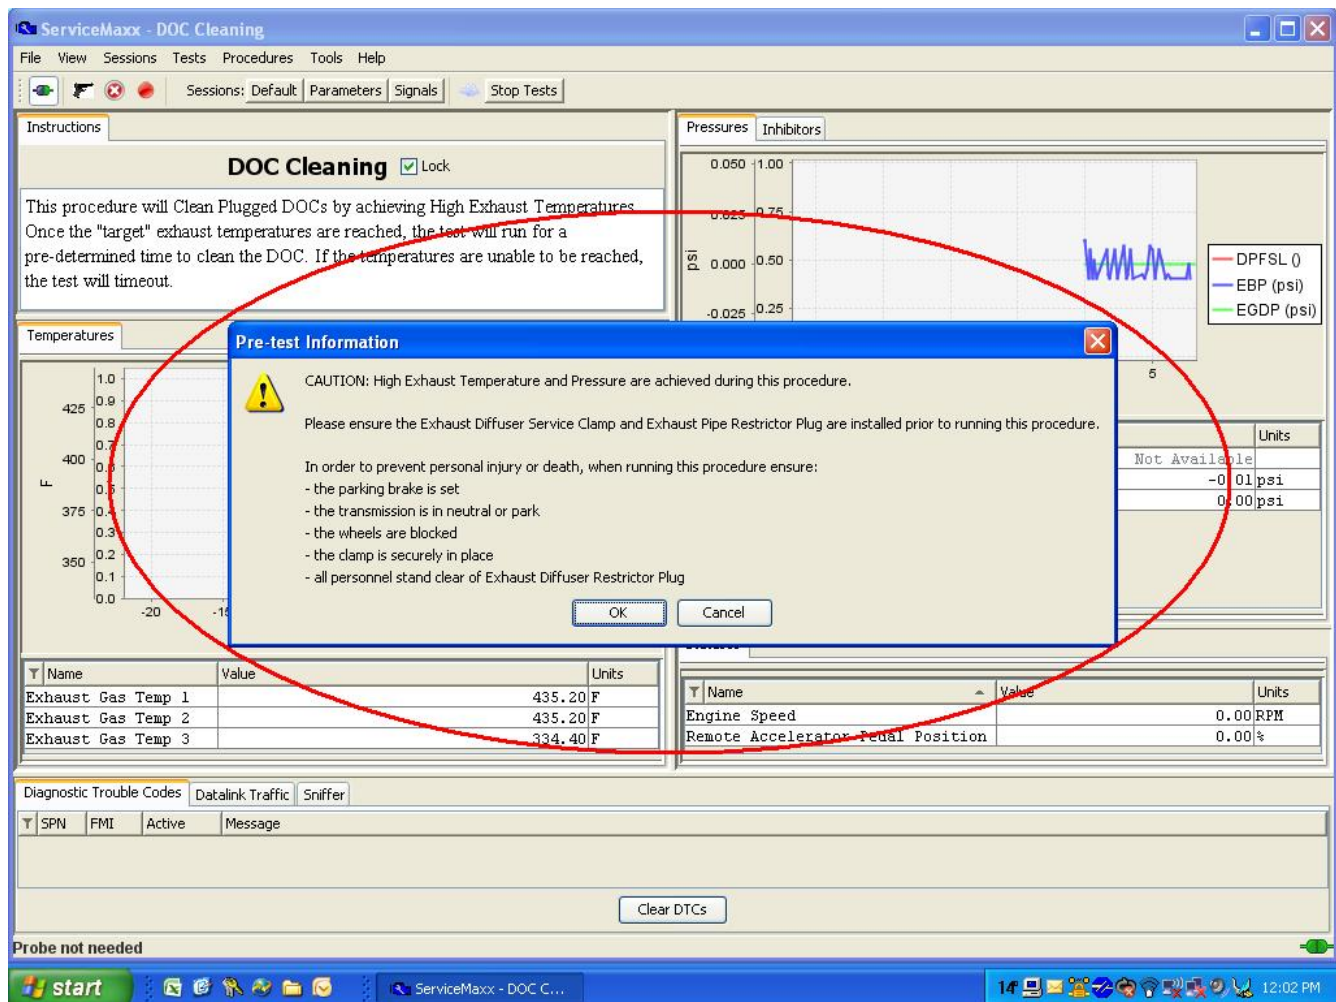


15. Start engine when prompted.

16. Click "Ok" after engine is running.

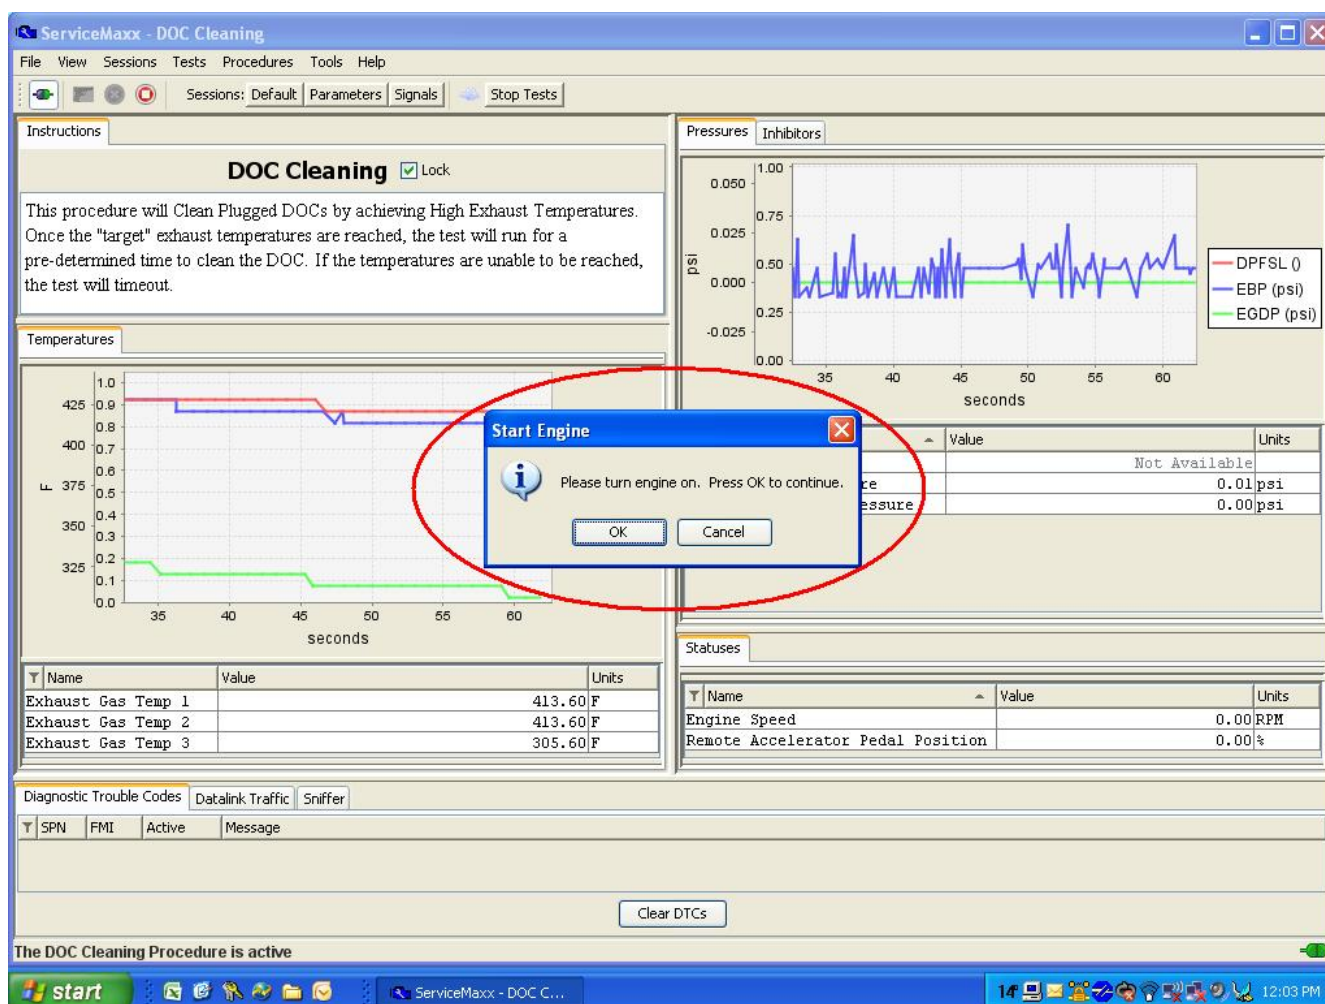


17. The cleaning procedure will now start, engine RPM increases automatically and will return to idle automatically after cleaning process has been completed. Procedure will run approximately 5 minutes after EGT 1 and EGT 2 reach 800 degrees..

Note : Procedure can be aborted at any time by touching any pedal.

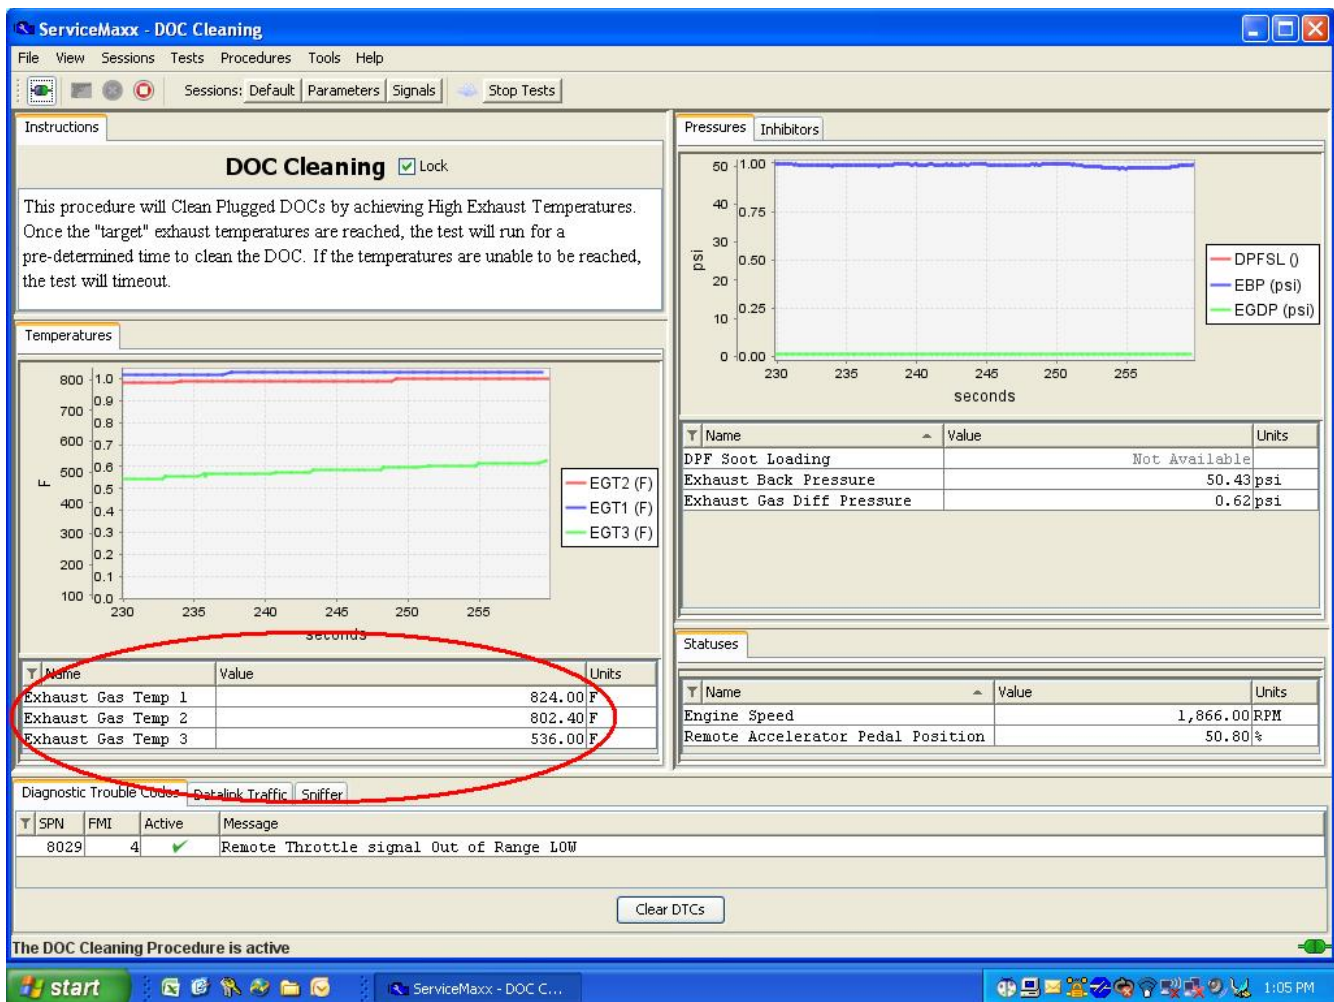


18. Allow engine to remain at idle until prompted to turn engine off.

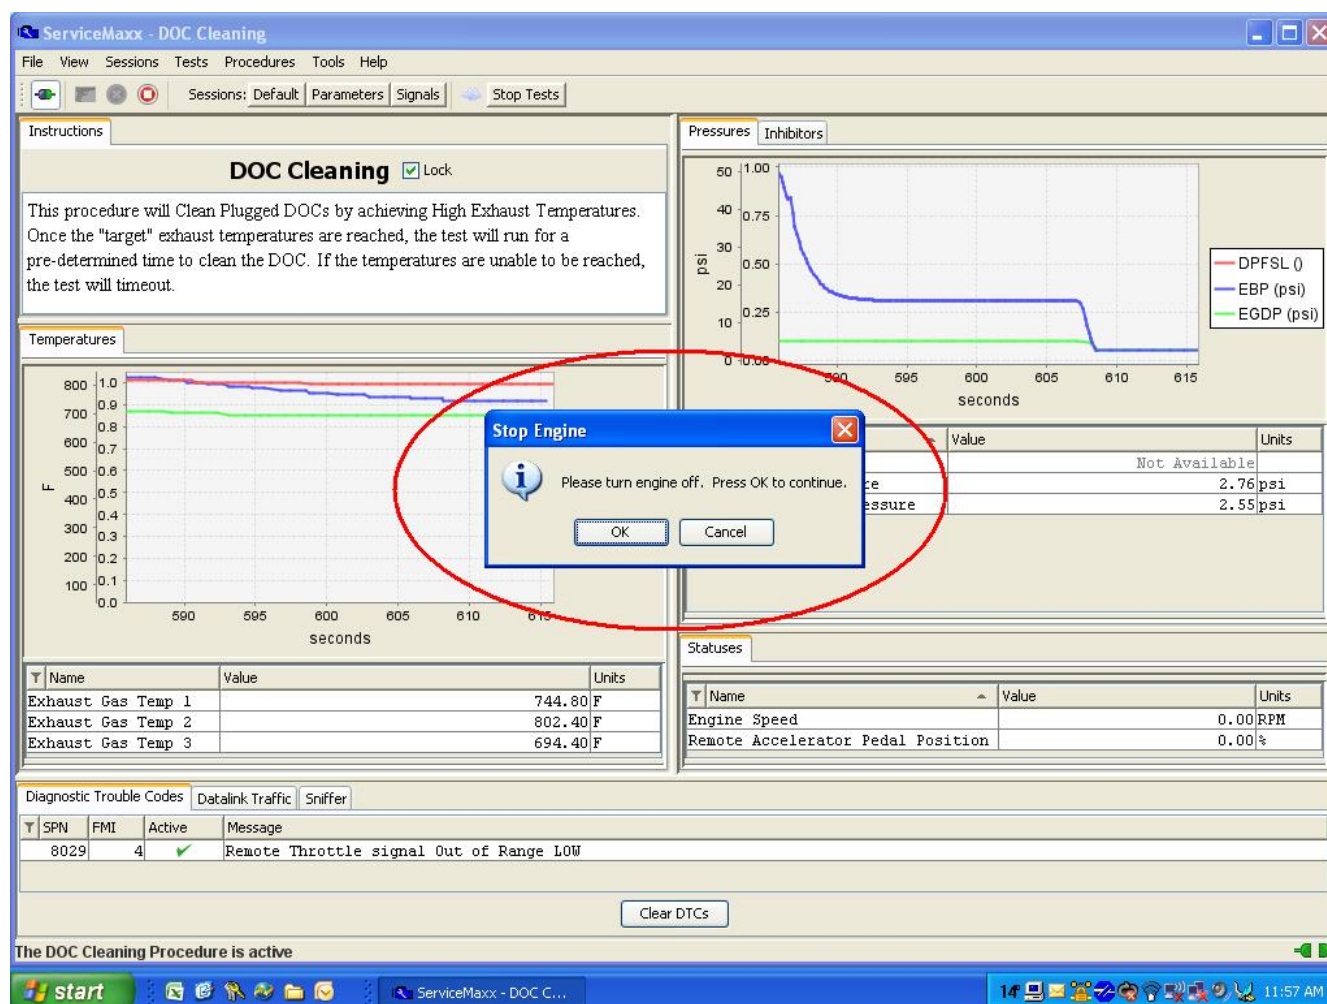


19. Leave engine off and click "Ok".


20. Turn Key On but leave engine off when prompted.

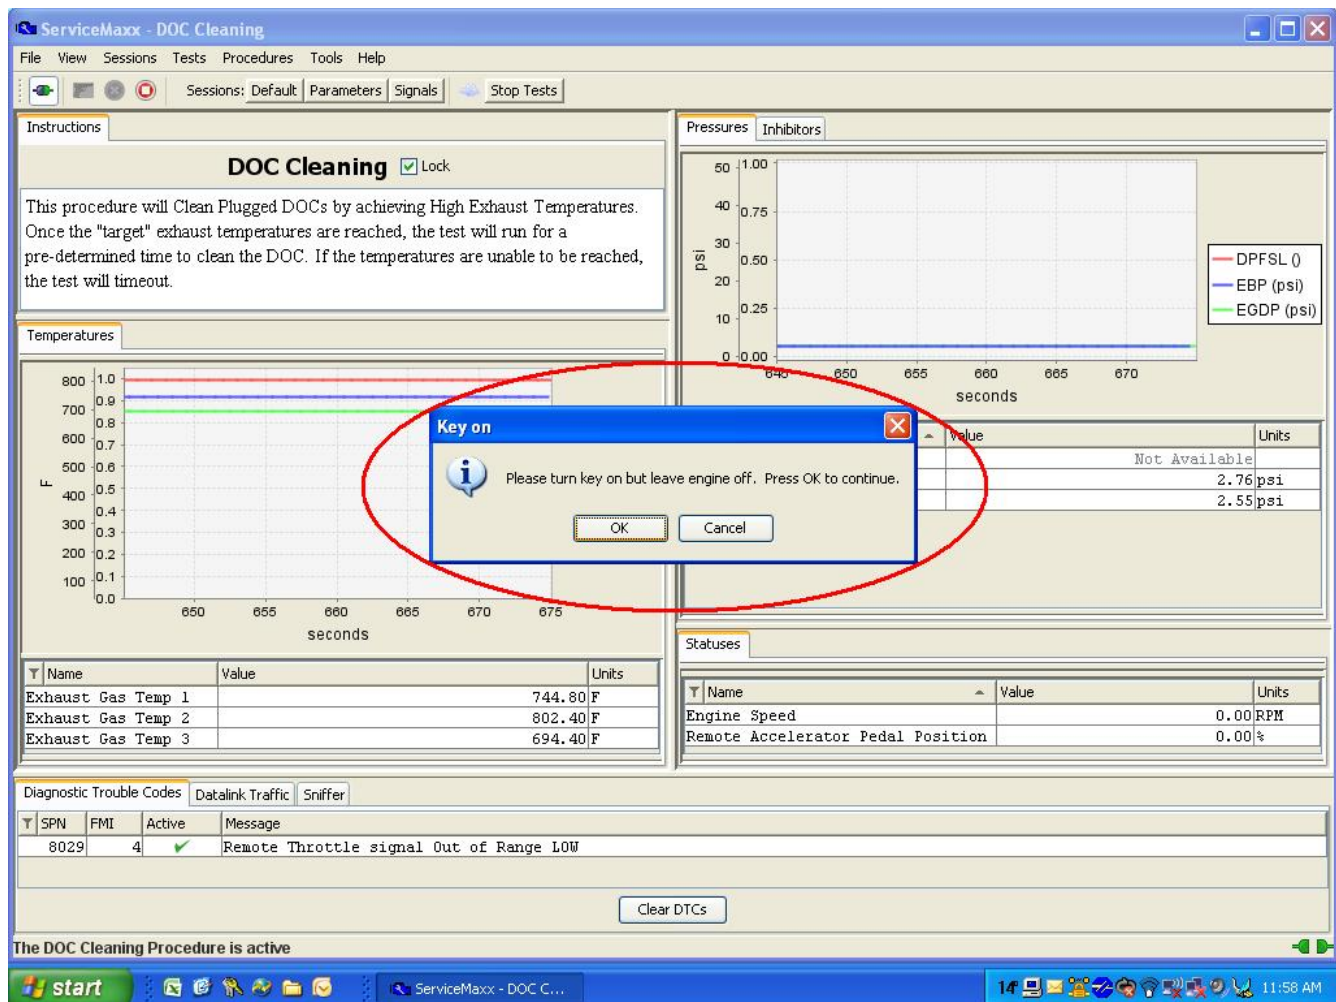

21. Click "Ok".
22. ServiceMaxx will now Change back the original parameters and clear the codes.
23. ServiceMax will automatically save a Snap Shot that needs to be attached to the case file.
24. Click "Ok".

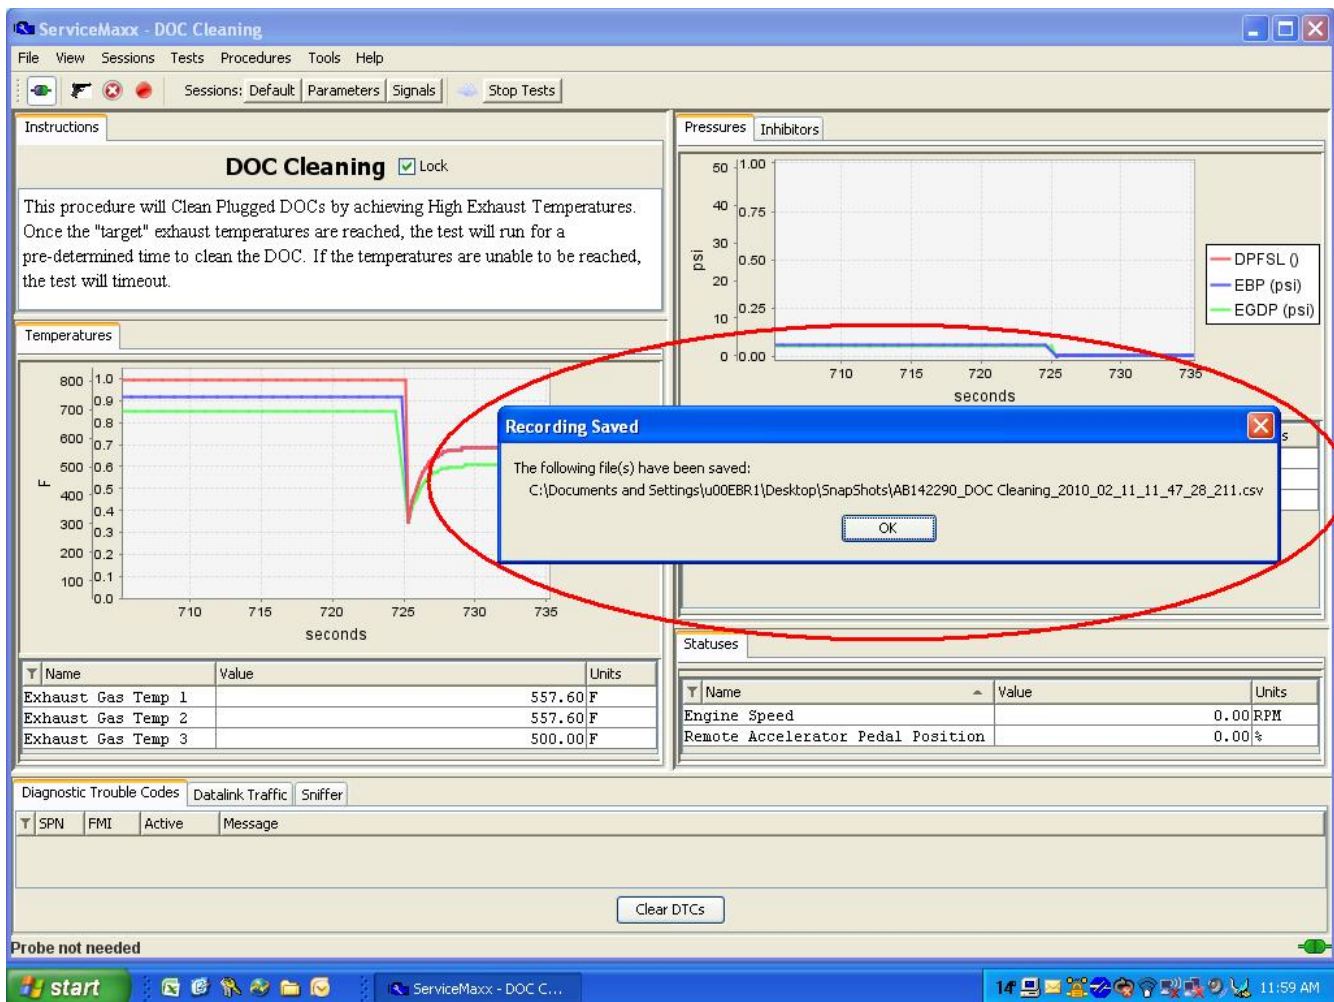

25. The cleaning procedure has been successfully performed with the "DOC Cleaned" prompt.

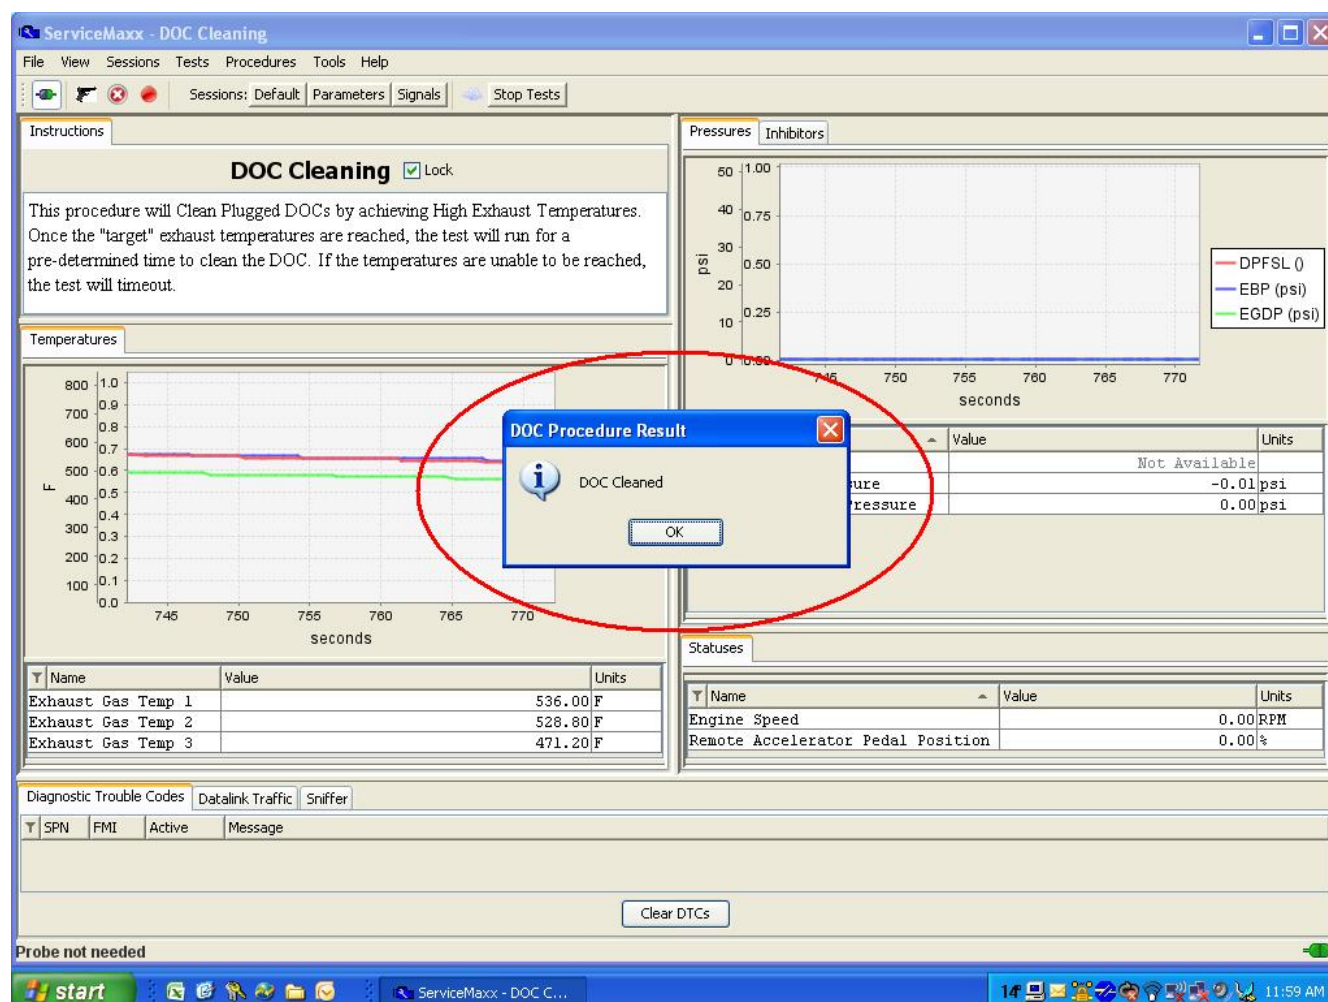

26. Click "OK".

27. Verify codes have been cleared.

28. ServiceMaxx can now be disconnected hood closed and unit moved back in building.

WARNING:

Exhaust will be very hot and care should be taken to prevent injury during the following steps. Wear Heat protective gloves.

29. Remove restrictor plate or cap

30. If the restrictor plate was used Inspect the gasket and reuse if possible.

31. Reinstall bolts, Torque bolts to 45 lbf-ft.

32. Remove EGDP Plug.

33. Reconnect EGDP hoses to tubes.

Note:

After Running the DOC Cleaning Procedure, fault code 1213 Remote Throttle Signal Out-of-Range may become active.

DTC	MODULE	DESCRIPTION
1213	ECM	Remote Throttle Signal Out-of-Range

RESOLUTION

Connect with Service Maxx, set ECM parameter 75001 to 2, In Cab Operation only.

 Hide Details

Feedback Information

Viewed: 24020

Helpful: 2732

Not Helpful: 1474

No Feedback Found

Copyright © 2014 Navistar, Inc.