










<b>Countries:</b>	CANADA, UNITED STATES	<b>Document ID:</b>	IK1600186
<b>Availability:</b>	ISIS, FleetISIS	<b>Revision:</b>	6
<b>Major System:</b>	CAB / SLEEPER / HOOD	<b>Created:</b>	8/27/2013
<b>Current Language:</b>	English	<b>Last Modified:</b>	2/4/2014
<b>Other Languages:</b>	NONE	<b>Author:</b>	Charles Schroeder
<b>Viewed:</b>	3697		

[Less Info](#)

Hide Details

Coding Information

<b>Copy Link</b> 	<b>Copy Relative Link</b> 	<b>Bookmark</b>  <a href="#">View My Bookmarks</a>	<b>Add to Favorites</b> 	<b>Print</b> 	<b>Provide Feedback</b> 	<b>Helpful</b>  21	<b>Not Helpful</b>  2
---	--	---	--	---	--	---	--

**Title: Cab Odor Service Plan Information**

**Applies To: ProStar, TranStar, WorkStar with EPA 2010 or Later  
MaxxForce 11 / 13 Engine**

## PURPOSE

This plan will provide all information needed to identify and repair a cab odor complaint in a ProStar with an EPA 2010 MaxxForce 11 / 13.

Launch the Service Plan from the iApprove Tab located in the Vehicle Information page of the Service Portal. [Click Here](#) for a screen shot of the information.

The Service Plan will guide you through the following:

## TRIAGE

Performed at write-up:

1. [Printable TRIAGE FORM](#)
2. Interrogate the driver for vehicle operational and maintenance details.
3. Check and document all vehicle Diagnostic Trouble Codes.
4. Check vehicle repair and warranty history.
5. Check for all open or incomplete campaigns.
6. Check Calibration Scorecard.

## STEP BY STEP WORK FLOW (DECISION TREE)

1. A [Printable FLOW CHART](#) of all steps, diagnostics and repairs.
2. This procedure does not require draining of coolant.

## PARTS

- List of all parts that may be required for repair:

PART NUMBER	DESCRIPTION	QUANTITY
7092423C91*	Kit, Exhaust Manifold Seal	1
3007667C92	Kit, EGR Hotside Tube GSKT / BT (Rear Ring Seal Removal / Installation Only)	1
2512186C91**	Kit, Rear Exhaust Manifold Seal	1
2511806C91	Kit, Cowl Tray	1

### NOTE:

**Order the EGR Hotside Tube GSKT / BT Kit (3007667C92) when servicing the rear exhaust manifold ring seal only.**

#### \*Exhaust Manifold Seal Kit (7092423C91) Contents

PART NUMBERS IN KIT (7092423C91)	DESCRIPTION	QUANTITY
3017160C1	Shield	2
3017161C1	Packing, Seal Assy	1
3017163C1	Ceramic, Mat Wrap Assy	1
1616029C1	Clamp, Constant Tension	2
4328147R1	Instruction Sheet	1

### NOTE:

**One Exhaust Manifold Seal Kit (7092423C91) is required for each exhaust manifold FEY ring joint.**

#### \*\*Rear Exhaust Manifold Seal Kit (2512186C91) Contents

PART NUMBERS IN KIT (2512186C91)	DESCRIPTION	QUANTITY
3007667C92	Kit, Hotside Tube Gaskets	1
7092423C92	Kit, Exhaust Manifold Seal	1
3007632C1	Bolt, M10 x 57	6
62917010831	Spacer, Sleeve	6

62089010284

Gasket, Exhaust Manifold

2

## TOOLS

1. 1/4" Drill Bit
2. Drill
3. General Hand / Air Tools

## ADDITIONAL RESOURCES

- [TSI 13-12-12](#) #5 and #6 Exhaust Manifold Gasket Removal and Installation Procedure
- [TSI 13-12-10](#) Exhaust Manifold Ring Seal Removal / Installation
- [IK1600183](#) Offensive Odors Inside Cabin

## WARRANTY

- Effective with warranty claims for all models 9/9/2013 and later. SRTs for Exhaust Manifold Ring Seals may not be combined with corresponding manifold gasket SRTs
- Cowl Tray repairs are only covered under Base Truck Warranty (01) or Service Contract (39) coverage if applicable. Be sure to verify coverage before claiming.

### NOTE:

- **File separate claim sections when addressing leaks at the cowl tray and the exhaust manifolds.**
- **If vehicle is beyond standard (01) warranty cowl tray repairs can be claimed under warranty code (40) under a separate claim section. Repair should NOT be done proactively (repair must address an "Odor in Cab" complaint). All claims submitted under warranty code 40 must be filed by Feb. 28, 2014.**

<b>Cab Odor Service Plan SRT's ProStar+ With EPA 2010 MaxxFORCE 11/ 13</b>		
<b>SRT Code</b>	<b>SRT Hours</b>	<b>Description</b>
R12-2001U	0.3	Cab Odor Service Plan Inspection
R16-1301A	0.7	Cowl Tray, Replace (Standard 01 Warranty)
A40-13665-1	0.7	Cowl Tray, Replace (Beyond 01 - file as warranty code 40)
R12-6356U-22	1.2	Exhaust Manifold Ring Seals, Install or Replace - Front
R12-6356U-23	2.4	Exhaust Manifold Ring Seals, Install or Replace - Rear
R12-6356U-24	3.1	Exhaust Manifold Ring Seals, Install or Replace - Both
R12-6356U-21	2.8	Exhaust Manifold Rear Section And/Or Gasket , Replace
R12-6356U-25	1.6	Exhaust Manifold Front Section And/Or Gasket, Replace

<b>Cab Odor Service Plan SRT's TranStar With EPA 2010 MaxxFORCE 11/ 13</b>		
<b>SRT Code</b>	<b>SRT Hours</b>	<b>Description</b>
Q12-2001U	0.3	Cab Odor Service Plan Inspection
Q12-6356U-22	1.2	Exhaust Manifold Ring Seals, Install or Replace - Front
Q12-6356U-23	1.7	Exhaust Manifold Ring Seals, Install or Replace - Rear
Q12-6356U-24	2.5	Exhaust Manifold Ring Seals, Install or Replace - Both
Q12-6356U-21	2.1	Exhaust Manifold Rear Section And/Or Gasket , Replace
Q12-6356U-25	1.6	Exhaust Manifold Front Section And/Or Gasket, Replace

<b>Cab Odor Service Plan SRT's WorkStar With EPA 2010 MaxxFORCE 11/ 13</b>		
<b>SRT Code</b>	<b>SRT Hours</b>	<b>Description</b>
N12-2001U	0.3	Cab Odor Service Plan Inspection
N12-6356U-22	1.2	Exhaust Manifold Ring Seals, Install or Replace - Front
N12-6356U-23	1.7	Exhaust Manifold Ring Seals, Install or Replace - Rear
N12-6356U-24	2.5	Exhaust Manifold Ring Seals, Install or Replace - Both
N12-6356U-21	2.1	Exhaust Manifold Rear Section And/Or Gasket , Replace
N12-6356U-25	1.6	Exhaust Manifold Front Section And/Or Gasket, Replace

Effective with warranty claims for all models 8/29/2013 and later. SRT's for Exhaust Manifold Ring Seals may not be combined with corresponding manifold/gasket SRT's.

- If you are installing Manifold Gaskets, the Manifold Ring seals are included in that repair.

 Hide Details

**Feedback Information**

Viewed: 3696

Helpful: 21

Not Helpful: 2

No Feedback Found