

BeSpoke Premium Audio Featuring Aha - Map Update Process

Service
Category Audio/Visual/Telematics

Section Navigation/Multi Info Display

Market USA

Scion Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2013 – 2014	FR-S, iQ, tC, xB, xD	

Introduction

Scion models equipped with the BeSpoke® Premium Audio featuring Aha™ require a Special Service Tool (SST) USB drive to update the map, points of interest, Gracenote®, and system software. The SST is used with all vehicles to deliver the update, however a unique Activation Number is required for each vehicle. Activation Numbers are provided in an Activation Card Number (ACN) pamphlet available through the normal parts ordering system. Use the process described in this bulletin to perform the update.

NOTE

Map data will be released annually through the shipment of a Special Service Tool USB drive to each dealer. The SST must be stored in the SST cabinet to ensure it can be easily found.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
N/A	Not Applicable to Warranty	–	–	–	–

BeSpoke Premium Audio Featuring Aha - Map Update Process

Parts Information

PART NUMBER	PART NAME	QTY
86272-HDD07-00	ACN NAV UPDATE - HARMAN (Pamphlet)	1

NOTE

Pamphlet is blue, with Toyota and Harman labels on the front cover.



Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
USB Drive Navigation Map Update - Harman Becker*	SCIH-EXT01-13	1

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

* Essential SST.

Repair Procedure

HINT

Connect a battery charger to the vehicle prior to beginning the process to ensure constant battery voltage.

1. Log into TIS.
2. Log into *Navigation Update Wizard*.
 - A. Click on the *TIS* tab.
 - B. Click on the *Diagnostics* tab.
 - C. Click on the *Navigation* tab.
 - D. Re-enter your password.
 - E. Click *Login*.

Figure 1.




BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)


3. Select *Harman* from the *Select Navigation Manufacturer* dropdown.

Figure 2.

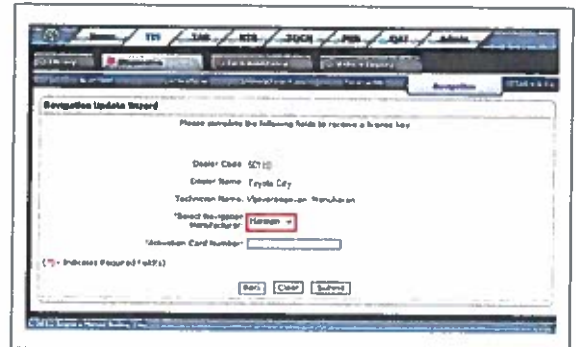

4. Enter the *Activation Card Number* from the inside of the pamphlet (obtained from parts department).

Figure 3.

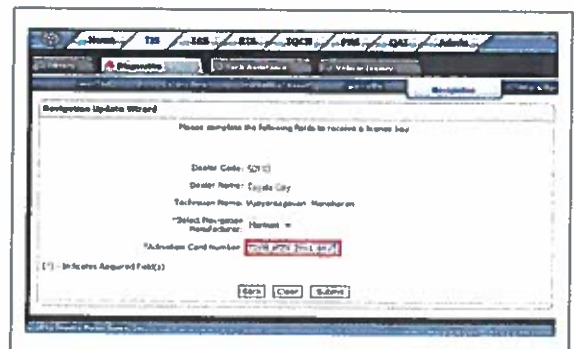

5. Click *Submit*.
6. Cycle Ignition ON (Ready OFF/Engine OFF).
7. Press the *SETUP* button on the navigation head unit.

Figure 4.




BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)


8. Select *General*.

Figure 5.

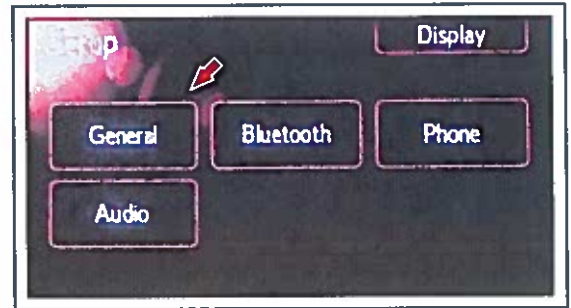


9. Press the down arrow and then select *System Information*.

Figure 6.

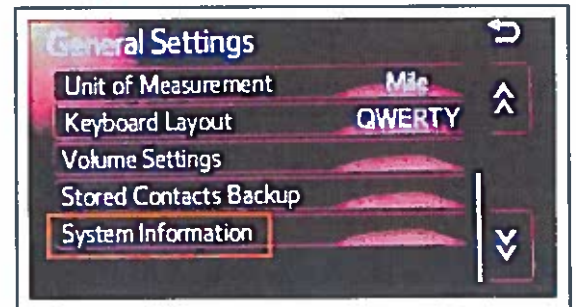

10. Record the *Nav ID*, located on the bottom left of the navigation screen.

Figure 7.

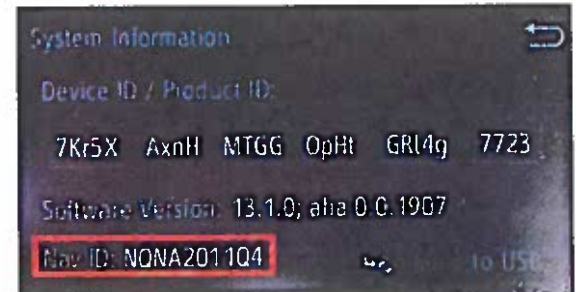


11. Insert the USB Drive SST into the USB port of the vehicle (usually located under the navigation head unit, center console/armrest, or glove box).

BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)


12. Select Yes.

Figure 8.

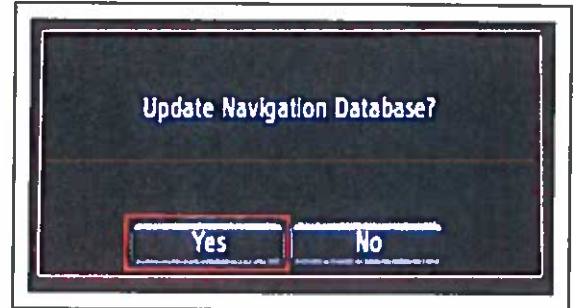

13. Record the *Request Code* from the navigation screen.


Figure 9.

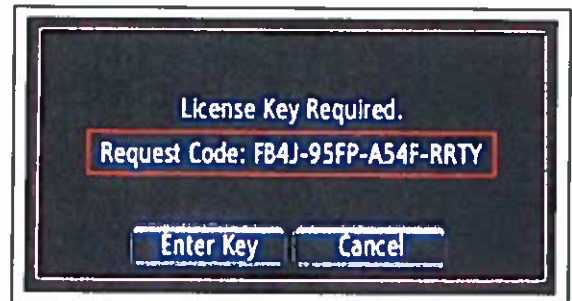

14. Enter navigation data into the *Navigation Update Wizard* form.

Figure 10.

- Select the correct USB part number (found on the SST packaging; starts with "SCIH").
- Input the *Request Code*.
- Input *Current Nav ID*.
- Input *VIN*.
- Input *Repair Order Number*.
- Click *Submit*.

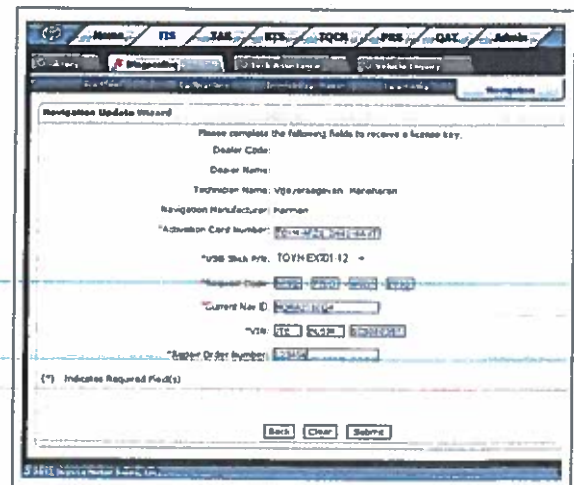

BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)

15. Check off each item after confirming that it is correct. If any of the information is incorrect, click *Back*.

Figure 11.



16. Click *Confirm*.
17. Note the License Key that is generated (print this page if necessary).

Figure 12.



18. Select *Enter Key*.

Figure 13.



BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)


19. Enter the License Key from step 17.

Figure 14.




20. Select OK.
21. Select Confirm.

Figure 15.

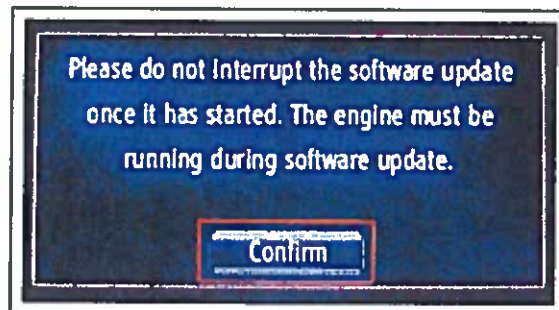

22. Navigation Map Update will begin automatically. The installation will update 10 packages (includes system software and Gracenote® updates) during this process and will automatically advance through each update.

Figure 16.

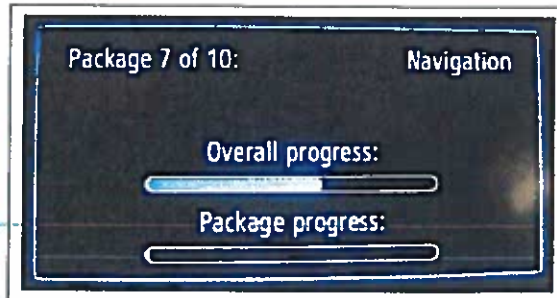

NOTE

If a battery charger is connected to the vehicle to maintain constant voltage, the vehicle does NOT need to be running (ensure that the vehicle ignition is ON (Ready OFF/Engine OFF)).

NOTE

This process will take about 35 minutes.

BeSpoke Premium Audio Featuring Aha - Map Update Process

Repair Procedure (Continued)

23. Remove the USB Drive SST from the vehicle to complete the Map Update.

Figure 17.



24. Map Update is complete.
25. Verify navigation operation.