

# Navigation System Firmware Update

**Service Category** Audio/Visual/Telematics

**Section** Navigation/Multi Info Display

**Market** USA

Lexus Supports  
ASE Certification 

## Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2014	GX460	

## Introduction

Some 2014 model year GX 460 vehicles equipped with navigation may exhibit one or more of the following conditions:

- The audio power off cannot be controlled for approximately 15 seconds after ignition cycle
- Navigation system resets while tuning XM Radio
- Slow update of HD Traffic Info
- Voice recognition is unavailable due to initialization\*

A software update is now available to address these conditions.

\* For this condition it is recommended that you also delete personal data on the head unit before the firmware update.

## Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EL1313	Update Software	0.3	86804-60B20	87	74

### APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

## Navigation System Firmware Update

### Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
USB Drive Firmware Update - Denso*	<a href="#">02015-DENSO-13D</a>	1

\* Essential SST.

**NOTE**

Additional SSTs may be ordered by calling 1-800-933-8335.


### Repair Procedure

1. Confirm the software version.
  - A. Cycle ignition to ACC. The *LEXUS* emblem will be displayed on the navigation screen.
  - B. Wait for the display to switch to the *Caution* screen, and then select *Continue*. The map screen will display.

Figure 1.



Figure 2.

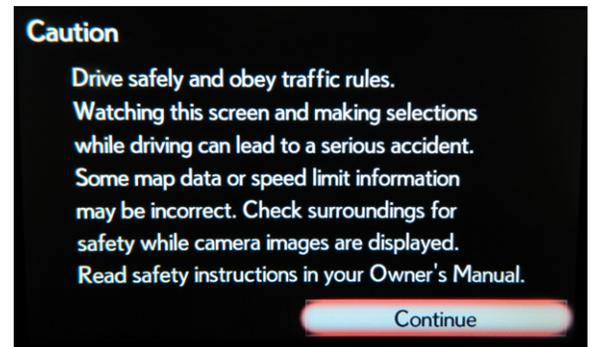


## Navigation System Firmware Update

---

### Repair Procedure (Continued)


- C. Enter the *Service Menu* by cycling the headlight switch ON/OFF 3 times while holding down the INFO button.

Figure 3.

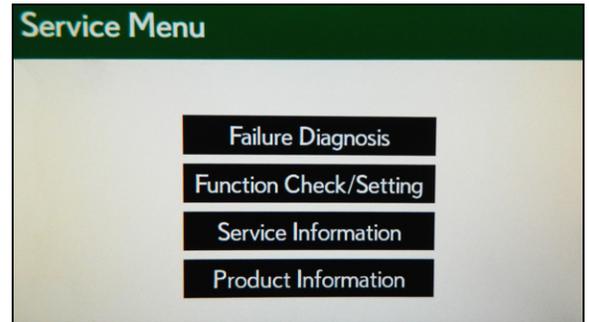


- D. Select *Service Information*.

Figure 4.

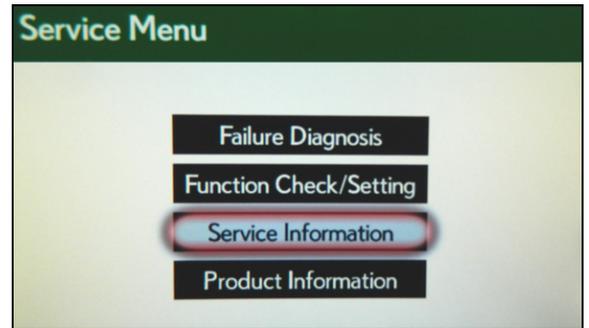

- E. Select *Version Information*.

Figure 5.

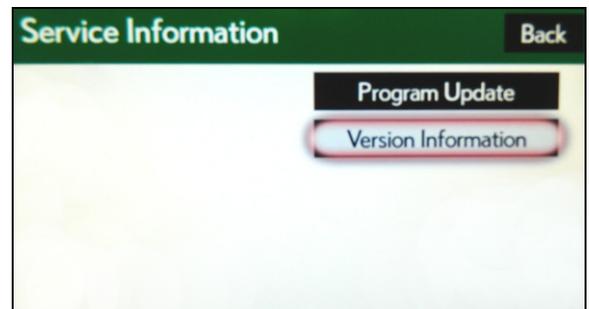


## Navigation System Firmware Update

### Repair Procedure (Continued)

F. Select *EMV-M*.

Figure 6.

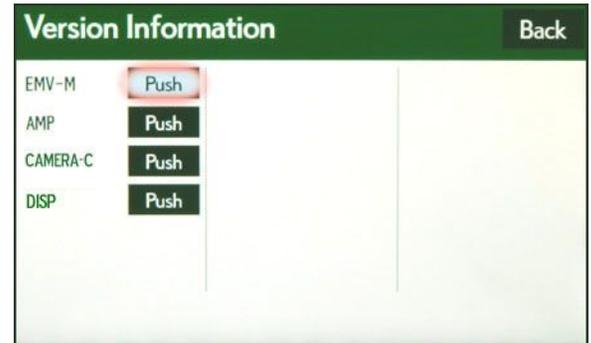


G. Confirm current version is older than new version.

- If the current version is V12A8110 or greater, **STOP** – this bulletin does NOT apply.
- If the current version is less than V12A8110, proceed to the next step.

2. Update software version.


A. Select *Back* twice.

Figure 7.

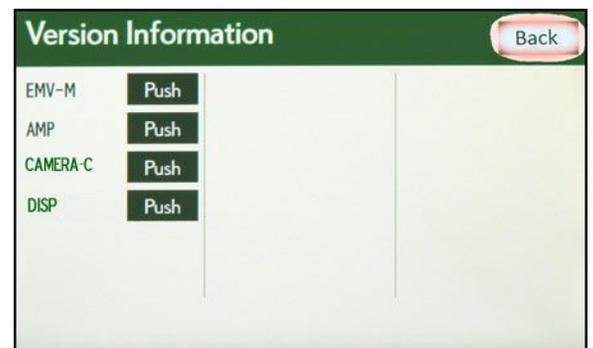

B. Select *Program Update*.

Figure 8.

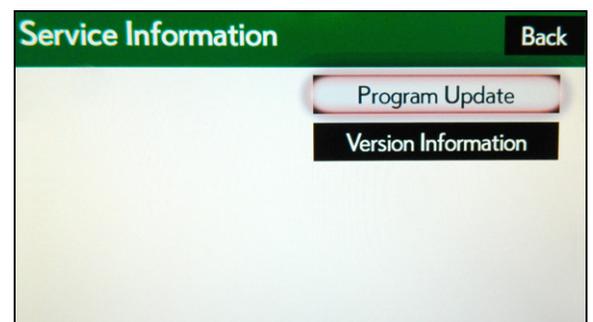

## Navigation System Firmware Update


### Repair Procedure (Continued)

- C. Connect USB Drive SST to the USB port in the auxiliary box.

**NOTICE**


**Do NOT attempt to close the auxiliary box lid. Doing so may result in damage to the USB Drive SST or USB port.**

Figure 9.

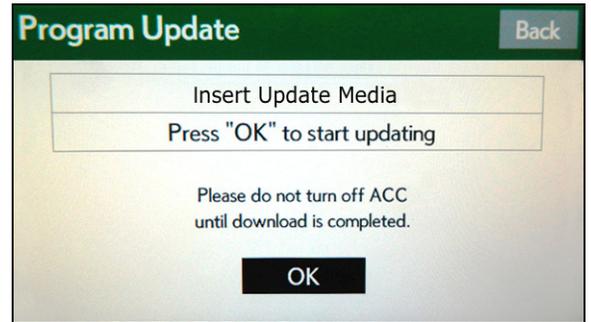


- D. Wait for the system to recognize the update media.

Figure 10.

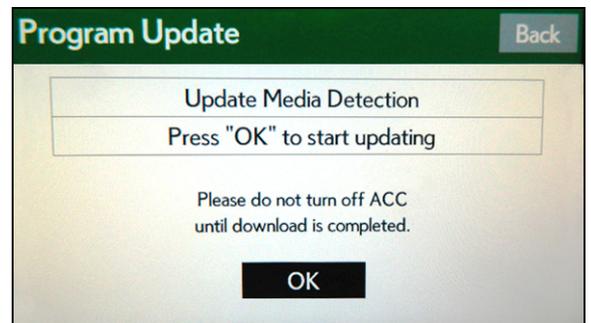

- E. Select *OK*.

Figure 11.

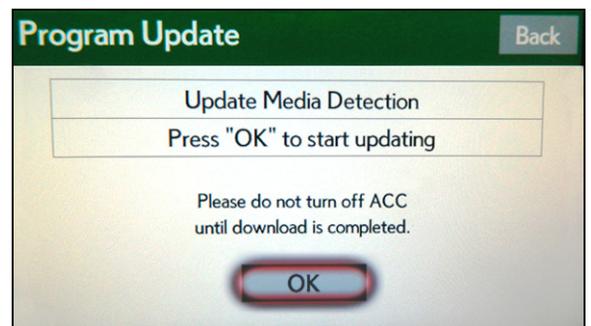


## Navigation System Firmware Update

### Repair Procedure (Continued)


F. Wait for the upload to finish. This should take about 2 – 3 minutes.

Figure 12.

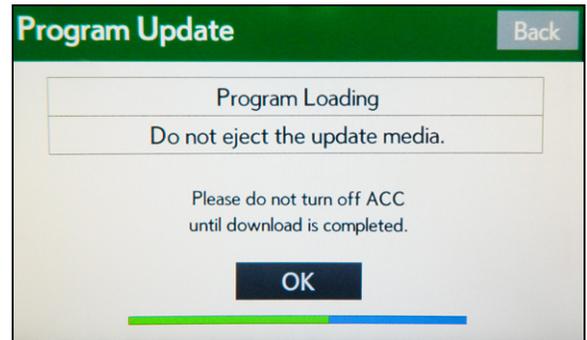


G. Once the upload finishes, the *ECU Selection* page will be displayed. Choose *Select* next to the new version.

Figure 13.

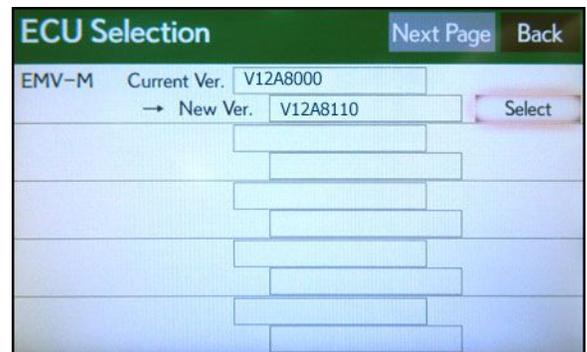

H. Select *OK* to confirm update.

Figure 14.

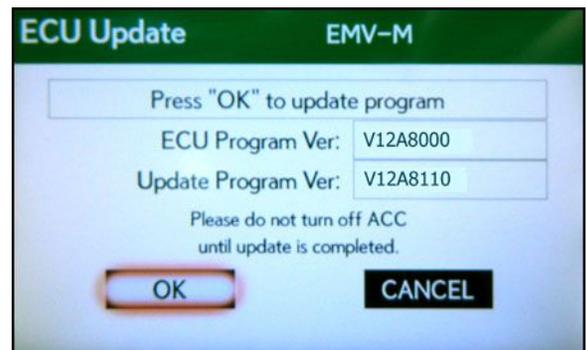


## Navigation System Firmware Update

### Repair Procedure (Continued)


- I. Wait until update is complete. This should take about 3 – 5 minutes.

Figure 15.

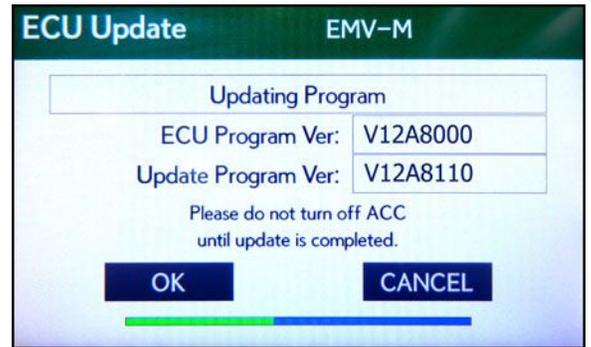


- J. Select *OK*.

Figure 16.

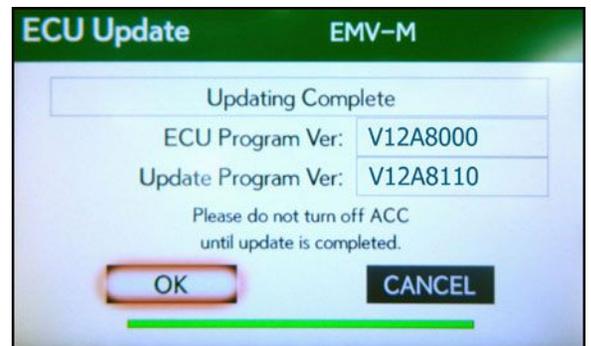

- K. Cycle ignition to the OFF position and remove the USB Drive SST.

Figure 17.

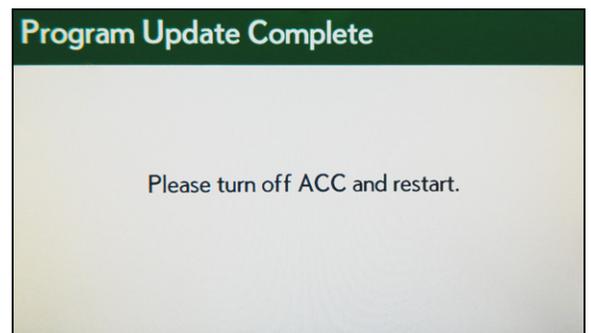


## Navigation System Firmware Update

### Repair Procedure (Continued)

- L. Cycle ignition to ACC and wait for the update to finish.

Figure 18.

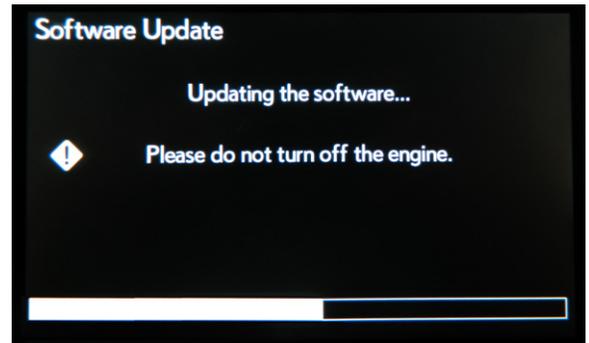


- M. Following the update, the system should boot up as usual with the *LEXUS* emblem.

Figure 19.



- 3. Confirm the software version is updated.
  - A. Perform sub-steps B – F of step 1 to navigate to the *Unit Version Information* screen.
  - B. Confirm Program Version is V12A8110.

Figure 20.

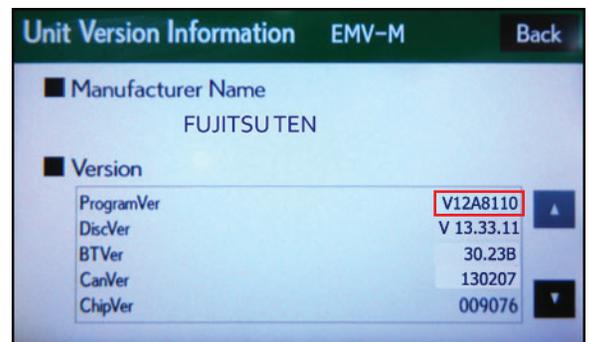

## Navigation System Firmware Update

---

### Repair Procedure (Continued)

- C. Exit *Service Mode* by cycling ignition OFF or holding down the HOME button for at least 5 seconds.

**NOTE**

If the screen shown appears after start-up, following the update, select *OK*.

Figure 21.

