S-SB-0013-14



Hard Start, Rough Idle, Camshaft Sensor or Misfire DTCs

| Service Category | Engine/Hybrid System | | | Scion Supports |
|---------------------|----------------------|--------|-----|-------------------------------------|
| Section | Engine Control | Market | USA | Scion Supports ASE Certification |

Applicability

| YEAR(S) | MODEL(S) | ADDITIONAL INFORMATION |
|---------|----------|------------------------|
| 2013 | FR-S | |

SUPERSESSION NOTICE

The information contained in this bulletin supersedes SB No. S-SB-0033-13.

• Parts Information and Repair Procedure sections have been updated.

Service Bulletin No. S-SB-0033-13 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this bulletin before proceeding.

Introduction

Some 2013 model year FR-S vehicles may exhibit intake and/or exhaust camshaft position sensor related and/or engine misfire DTCs (P0340, P0341, P0345, P0346, P0365, P0366, P0390, P0391, P0301, P0302, P0303, and P0304) due to the camshaft position sensor clearance being out of specification. In addition, some vehicles may also experience rough idle or extended cranking. This bulletin provides inspection and repair procedures to improve this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VIN shown below.

| MODEL | PRODUCTION CHANGE EFFECTIVE VIN | |
|-------|---------------------------------|--|
| FR-S | JF1ZNAA1#D#721474 | |

Warranty Information

| OP CODE | DESCRIPTION | TIME | OFP | T1 | T2 |
|---------|----------------------------|------|-------------|----|----|
| EG1311 | R & R Shim Camshaft Sensor | 0.6 | SU003-00186 | 07 | 44 |

APPLICABLE WARRANTY

- This repair is covered under the Toyota Powertrain Warranty. This warranty is in effect for 60 months or 60,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

| PART NUMBER | PART NAME | QTY |
|-------------|--|-----------|
| SU003-00184 | O-Ring Camshaft (Bank 1 Exhaust Only) | As Needed |
| SU003-00185 | O-Ring Camshaft (All Others) | As Needed |
| SU003-04660 | Repair Part Set* (Bank 1 Exhaust Only) | 1 |
| SU003-04600 | Repair Part Set* (All Others) | 1 |

* Refer to the table below for the list of parts included in both Repair Part Sets (also called "Shim Kits").

| SU003-04660 | SU003-04600 | | | |
|-------------------------------------|---|--|------------------------|--------------------|
| PART NUMBER RH (B1) EXHAUST ONLY | PART NUMBER INTAKE AND LH (B2) EXHAUST ONLY | CAM SENSOR MEASURED CLEARANCE (MM) | SHIM THICKNESS (MM) | TARGET GAP (MM) |
| 10130-AA170 | 10130-AA070 | 0.45 – 0.55 | 0.8 | 1.25 – 1.35 |
| 10130-AA180 | 10130-AA080 | 0.56 – 0.65 | 0.7 | 1.26 – 1.35 |
| 10130-AA190 | 10130-AA090 | 0.66 – 0.75 | 0.6 | 1.26 – 1.35 |
| 10130-AA200 | 10130-AA100 | 0.76 – 0.85 | 0.5 | 1.26 – 1.35 |
| 10130-AA210 | 10130-AA110 | 0.86 – 0.95 | 0.4 | 1.26 – 1.35 |
| 10130-AA220 | 10130-AA120 | 0.96 – 1.05 | 0.3 | 1.26 – 1.35 |
| 10130-AA230 | 10130-AA130 | 1.06 – 1.15 | 0.2 | 1.26 – 1.35 |
| 10130-AA240 | 10130-AA140 | 1.16 – 1.25 | 0.1 | 1.26 – 1.35 |

Required Tools & Equipment

| REQUIRED EQUIPMENT | SUPPLIER | PART NUMBER | QTY |
|--------------------|----------|-------------|-----|
| Techstream 2.0** | | TS2UNIT | |
| TIS Techstream | ADE | TSPKG1 | 1 |
| Techstream Lite | | TSLITEDLR01 | |

** Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 9.10.037 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.


| REQUIRED EQUIPMENT | QTY |
|---------------------------------------|-----|
| Digital Caliper with Depth Attachment | 1 |

Inspection Procedure

- 1. Confirm MIL "ON" with camshaft sensor DTC as described in the Introduction.
- 2. Disconnect the negative (–) battery cable.
- 3. Proceed to the applicable Repair Procedure based on the DTC listed in the table below.

| DTC | BANK | CONDITION | SHIM KIT P/N | O-RING P/N | REPAIR PROCEDURE |
|-------|------------------------------|-------------------------|--------------|-------------|------------------|
| P0340 | D1 | Circuit | | SU003-00185 | |
| P0341 | B1 Intake B2 Intake | Circuit/ Performance | SU003-04600 | | Intake Camshaft |
| P0345 | | Circuit | | | Position Sensor |
| P0346 | | Circuit/ Performance | | | |
| P0390 | B2 | Circuit | | | |
| P0391 | Exhaust | Circuit/ Performance | | | Exhaust Camshaft |
| P0365 | B1 | Circuit | | | Position Sensor |
| P0366 | Exhaust | Circuit/ Performance | SU003-04660 | SU003-00184 | |

Figure 1.

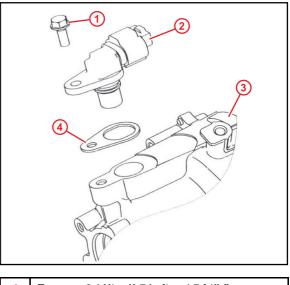

| 1 | Torque = 6.4 N*m (0.7 kgf*m, 4.7 ft*lbf) |
|---|--|
| 2 | Camshaft Sensor |
| 3 | Timing Chain Cover |
| 4 | Shim (to Be Added) |




Repair Procedure: Intake Camshaft Position Sensor

1. Remove applicable camshaft sensor.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

- 2013 FR-S: Engine/Hybrid System – Engine Control – "FA20 Engine Control: Camshaft Position Sensor: <u>Removal</u>"
- Take measurement "A" (top of timing chain cover to camshaft position sensor plate) on the 3 sections of the sensor plate (at approximately 70° apart) and record the readings.

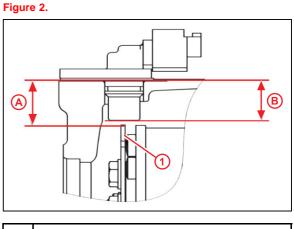




A. Take measurement "A" and record the reading. Figure 3.

NOTE

When measuring "A" make sure you are measuring the outside diameter or "top" of the sensor plate, and NOT in the notch as shown in Figure 3. Be sure to record all measurements.

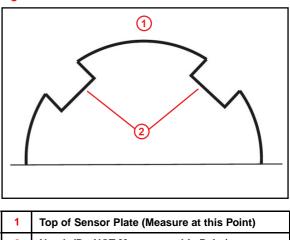

2 Notch (Do NOT Measure at this Point)



Repair Procedure: Intake Camshaft Position Sensor (Continued)



B. Using a breaker bar and 22 mm socket, place the socket on the crankshaft pulley bolt and rotate the engine clockwise approximately 70°. Keep in mind NOT to measure the notches as described in Figure 3.

NOTICE

Do NOT rotate the engine counterclockwise, doing so will loosen the crankshaft pulley bolt. If the engine is accidentally turned counterclockwise, make sure the bolt is re-torqued following the proper procedure in the applicable Repair Manual.

C. Use the smallest of the 3 measurements and record the result.



Repair Procedure: Intake Camshaft Position Sensor (Continued)

 Take measurement "B" (camshaft position sensor mating surface to the bottom of the sensor, refer to Figure 2) and record the readings.

NOTE

When taking measurement "B" use a flat steel ruler, or equivalent, along with the Digital Caliper.

A. Measure the distance between the camshaft position sensor mounting surface and the bottom of the sensor as shown.

NOTE

The specified clearance is 1.3 +/- 0.05 mm (1.25 to 1.35 mm or 0.049 to 0.053 in.).

Example calculation:

- A = Top of timing chain cover to camshaft position sensor plate
- B = Camshaft position sensor mating surface to the bottom of the sensor
- A = 23.70 mm
- B = 22.58 mm
- A B = 1.12 mm (clearance)

In this example a 0.2 mm shim is required.

B. Select appropriate shim and go to step 4.


NOTE Select ONLY 1 shim. Do NOT stack shims.

4. Install the NEW O-Ring Camshaft (one time use item).

Refer to TIS, applicable model and model year Repair Manual:

- 2013 FR-S: Engine/Hybrid System – Engine Control – "FA20 Engine Control: Camshaft Position Sensor: <u>Installation</u>"
- 5. Reinstall the camshaft position sensor and shim.

Figure 5.

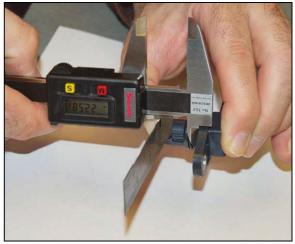


Repair Procedure: Intake Camshaft Position Sensor (Continued)

- Tighten the sensor retaining bolt.
 Torque: 6.4 N*m (0.7 kgf*cm, 4.7 ft*lbf)
- 7. Reconnect the sensor engine wiring harness connector.
- 8. Reconnect the negative (-) battery cable to complete the repair.
- 9. Clear the ECM memory before returning the vehicle to the customer.
- 10. Confirm repair by test driving the vehicle and confirm that the DTCs do NOT reset.

Repair Procedure: Exhaust Camshaft Position Sensor

Use the following procedure if your DTC pertains to the exhaust side sensor.

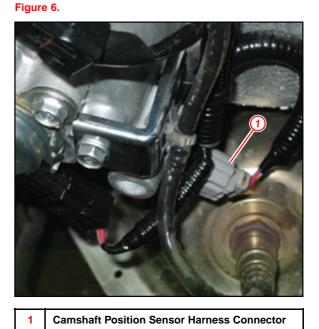

- 1. Confirm DTC pertains to the exhaust side camshaft sensor (see DTC chart in the Inspection Procedure to determine which Shim Kit and O-ring to use).
- 2. Remove the applicable sensor from the timing cover and install a 0.2 mm thick shim from the applicable kit. If the DTC returns, use the next thicker shim (0.3 mm) and repeat as needed increasing the shim thickness 0.1 mm at a time.

NOTE

Select ONLY 1 shim. Do NOT stack shims.



Repair Procedure: Exhaust Camshaft Position Sensor (Continued)

3. Install the NEW O-Ring Camshaft (one time use item).

Refer to TIS, applicable model and model year Repair Manual:

- 2013 FR-S: Engine/Hybrid System – Engine Control – "FA20 Engine Control: Camshaft Position Sensor: <u>Installation</u>"
- 4. Reinstall the camshaft position sensor and shim.
- 5. Tighten the sensor retaining bolt. Torque: 6.4 N*m (0.7 kgf*cm, 4.7 ft*lbf)
- 6. Reconnect the sensor engine wiring harness connector.
- 7. Reconnect the negative (-) battery cable to complete the repair.
- 8. Clear the ECM memory before returning the vehicle to the customer.
- 9. Confirm repair by test driving the vehicle and confirm that the DTCs do NOT reset.